 



1 YEAR
WARRANTY



User's Guide

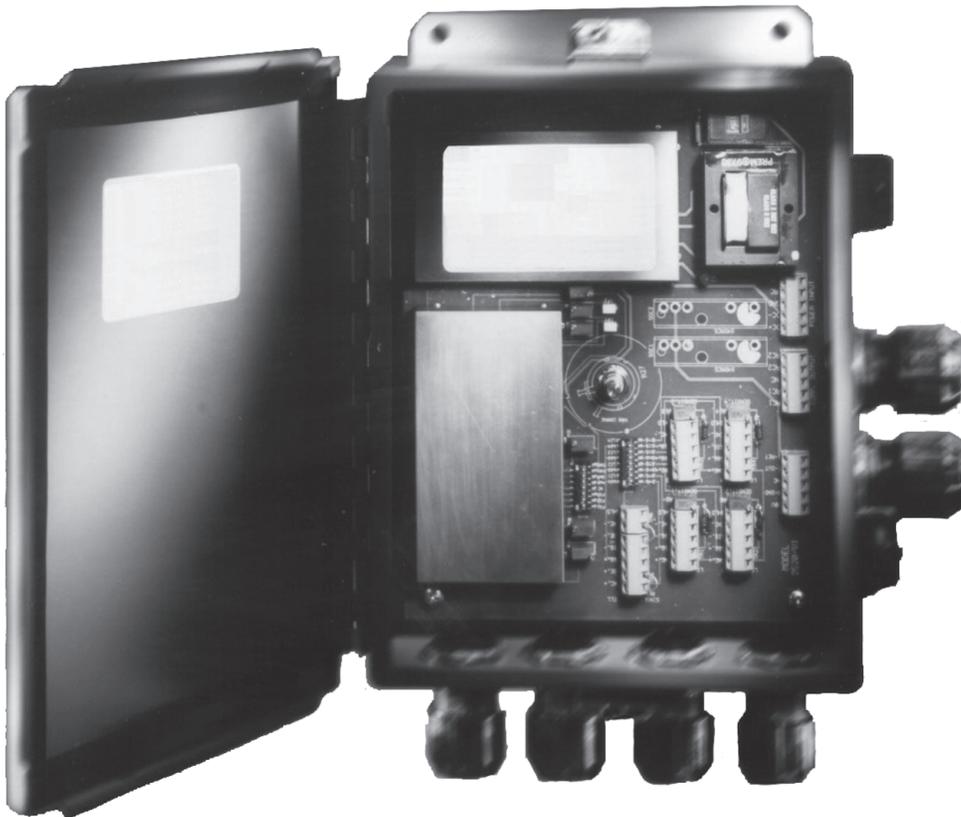

Shop online at

omega.com[®]

Ω OMEGA[®]

omega.com

e-mail: info@omega.com

*For latest product manuals:
omegamanual.info*

ISO 9001
CERTIFIED
CORPORATE QUALITY
STAMFORD, CT

ISO 9001
CERTIFIED
CORPORATE QUALITY
MANCHESTER, UK

JBOX-4800 **Summing Box/Transmitter**



OMEGAnet® Online Service omega.com	Internet e-mail info@omega.com
---	---

Servicing North America:

U.S.A.: ISO 9001 Certified Omega Engineering, Inc., One Omega Drive, P.O. Box 4047
Stamford, CT 06907-0047 USA
Toll Free: 1-800-826-6342 TEL: (203) 359-1660
FAX: (203) 359-7700 e-mail: info@omega.com

Canada: 976 Bergar
Laval (Quebec), H7L 5A1 Canada
Toll-Free: 1-800-826-6342 TEL: (514) 856-6928
FAX: (514) 856-6886 e-mail: info@omega.ca

For immediate technical or application assistance:

U.S.A. and Canada: Sales Service: 1-800-826-6342/1-800-TC-OMEGA®
Customer Service: 1-800-622-2378/1-800-622-BEST®
Engineering Service: 1-800-872-9436/1-800-USA-WHEN®

**Mexico/
Latin America:** En Español: 001 (203) 359-7803 FAX: 001 (203) 359-7807
info@omega.com.mx e-mail: espanol@omega.com

Servicing Europe:

Benelux: Managed by the United Kingdom Office
Toll-Free: 0800 099 3344 TEL: +31 20 347 21 21
FAX: +31 20 643 46 43 e-mail: sales@omegaeng.nl

Czech Republic: Frystatska 184
733 01 Karviná, Czech Republic
Toll-Free: 0800-1-66342 TEL: +420-59-6311899
FAX: +420-59-6311114 e-mail: info@omegashop.cz

France: Managed by the United Kingdom Office
Toll-Free: 0800 466 342 TEL: +33 (0) 161 37 29 00
FAX: +33 (0) 130 57 54 27 e-mail: sales@omega.fr

Germany/Austria: Daimlerstrasse 26
D-75392 Deckenpfronn, Germany
Toll-Free: 0800 6397678 TEL: +49 (0) 7056 9398-0
FAX: +49 (0) 7056 9398-29 e-mail: info@omega.de

United Kingdom: ISO 9001 Certified OMEGA Engineering Ltd.
One Omega Drive, River Bend Technology Centre, Northbank
Irlam, Manchester M44 5BD United Kingdom
Toll-Free: 0800-488-488 TEL: +44 (0) 161 777-6611
FAX: +44 (0) 161 777-6622 e-mail: sales@omega.co.uk

It is the policy of OMEGA Engineering, Inc. to comply with all worldwide safety and EMC/EMI regulations that apply. OMEGA is constantly pursuing certification of its products to the European New Approach Directives. OMEGA will add the CE mark to every appropriate device upon certification. The information contained in this document is believed to be correct, but OMEGA accepts no liability for any errors it contains, and reserves the right to alter specifications without notice.
WARNING: These products are not designed for use in, and should not be used for, human applications.

JBox-4800

SUMMING BOX / TRANSMITTER

OPERATIONAL MANUAL

I. GENERAL DESCRIPTION

1. Features	2
2. Application.....	2
3. Brief Description.....	3
4. Operation	3
5. Specification.....	4
6. Instrument layout.....	5

II. INSTALLATION

1. Item check list	7
2. Mounting	7
3. Electrical Connections.....	7

III. SETUP

1. Setting the Excitation Voltage	10
2. Single Load Cell System Adjustment	10
3. Multiple Load Cell System Adjustment.....	10
4. Troubleshooting.....	12

IV. OPTIONS

1. Enclosures	14
2. Dual Set Points (Installation and Setup)	14

I. GENERAL DESCRIPTION

1. Features

- Summing of up to 4 load cells
- Complete strain gage bridge signal conditioner
- High gain, low drift, low temperature coefficient precision amplifiers, with low input current (10 pA typical)
- Wide input range from 5 mV to 50 mV full scale
- Very stable bridge balance with 80% tare offset capability
- 4-20 mA or 0-20 mA output
- 2 to 10 V or 0 to 10 V output
- Excitation supply capable of driving four load cells
 - Typical 0.001% temperature coefficient
 - Wide adjustment voltage range
 - Long distance remote sense capability
 - Very good line and load regulation
- Both AC and DC power capability
 - Input, output and power three way isolation
- NEMA 4 enclosure for use in rugged environments

2. Application

- Precision weighing with load cells
- Process control add-on loops
- Can be used with all types of low output sensors

3. Brief Description

The JBox-4800 is an AC or DC powered Summing Transmitter for up to four load cells with output options of 0 to 20 mA, and 0 to 10 V or 4 to 20 mA, and 2 to 10 V. All input/output options are included on one board so there is no need to specify input/output parameters with the JBox-4800.

The JBox-4800 has a built in excitation supply capable of delivering up to 120 mA from 5 to 10 V, more than enough current to drive four 350 ohm load cells.

The JBox-4800 offers three way isolation, input to output and power, eliminating unwanted ground loop problems. Overall accuracy over the normal room temperature range is excellent at $\pm 0.1\%$ of full scale. The high gain, very low drift and very low temperature coefficient of the 4800 amplifier allows full scale live load signals as low as 5 mV to be amplified to 20 mA or 10 V.

Designed with large and very stable tare offset requirements, the JBox-4800 can tare off up to 80% of the output of a 3 mV/V load cell (at 10 V excitation).

If high/low setpoint alarms/controls are desired, the JBox-4800 board is laid out to accept Opto-22 output relays. Potentiometers are accessible to adjust the high and low trip points.

4. Operation

The JBox-4800 accepts DC mV signals from up to four load cells which are summed together, then amplified, isolated and filtered. The JBox-4800 features a very stable on-board excitation supply and precision amplifier. They are designed for very low drift and a small temperature coefficient, critical for high accuracy. The full scale output is either a 20 mA or 10 V signal for industrial control. A wide AC and DC power voltage range is allowed for convenience.

5. Specifications


NOTE: Unless otherwise noted, specifications apply after a 30 minute warm up at 23°C ±2°C ambient. Temperature Coefficients apply between 0°C and 55°C ambient.

ACCURACY	
10 to 35°C, at 10 V Excitation	Less than ±0.1%
Total Temperature Coefficient (TC)	0.0025%/°C typ
ISOLATION	
AC or DC Powered - Three Way Isolated	
AC to Input and Output	750 VAC
DC to Input to Output	300 VDC 500 pF
AMPLIFIER SECTION	
Gain	
Input Range	5 mV to 50 mV Full Scale
Linearity	±0.01% of Full Scale
TC	0.0015%/°C typ
Input Noise - 0.1 Hz to 10 Hz	2 µV PP
Tare Adjustment Range	-3 mV to +6.5 mV
(Bridge Offset)	+6.5 mV to +16mV
(Equals 80% F.S of 3 mV/V cell at 10 V)	+16 mV to +25 mV
Temperature Coefficient	0.0015% /°C typ
Common Mode Rejection	100 dB Min
Common Mode Input Voltage	+5 Volts Max
OUTPUT	
Zero Selection	0 or 4 mA 0 or 2 V
Temperature Coefficient	0.001 %/°C typ
Test Signal Output	Add 8 mA or 4 V to output
Current Output Span	
Current	0 or 4 to +20 mA Available 0 to -0.3 mA for zero monitor
Compliance Voltage	0 to +20 Volts
Loop Resistance	0 to 1000 ohms
Voltage Output Span	
Voltage	0 or 2 to 10 V Available -2 to 10 V
Maximum Load Current	5 mA
Frequency Response	
2 Poll roll off	-3dB at 10 Hz typ
Response Time	
Rise Time 10% to 90%	35 mS
To 0.1% of Final value	100 mS

COMPARATOR OUTPUT Optional with Opto22 I/O Module	
Comparative Voltage	0 to 10 V
Hysteresis Voltage	0.07 V typ
Comparator Output	see the specification of OPTO22 output module
Input/Output Isolation	300 V
BRIDGE EXCITATION SUPPLY	
Voltage Adjustment Range	5 to 10 V
Temperature Coefficient	0.001% typ at 10 V
Load Current	0 to 120 mA
Remote Sense for Excitation Supply	
Current Leads Volts Drop	Max 1 V drop
Sensing Leads Resistance	Max 1 kohm
Line Regulation	Less than 0.01%, typ 0.002%
Load Regulation	Less than 0.03%, typ 0.005%
Output Noise 120 Hz Bandwidth	1 mV RMS, typ
POWER INPUT	LED power on indicator
AC	115 V (90 to 130 V) / 230 V (180 to 260 V) 50 / 60 Hz, 10 W typ
DC	11 to 30 V, 8 W
ENVIRONMENT	
Operating Temperature	-25°C to +55°C
Storage Temperature	-25°C to +85°C
WEIGHT	10.5 lb (4.7 kg)
JUNCTION BOX	10" L x 8" W x 4" H, NEMA 4 Box or NEMA 4X Stainless Steel Box
TOTAL SIZE	12.5" x 9" x 4.4" (318 mm x 229 mm x 112 mm)

6. Instrument Layout

The components are assembled on one printed circuit board which is mounted inside of a NEMA 4 box. The T & B Non-Metallic Liquidtight Strain Relief Connectors are used for weatherproofing and corrosion resistance. Four connectors on one side of the box are used for load cell connections. Two connectors on another side of the box are used for output signals, relay outputs and power connections.

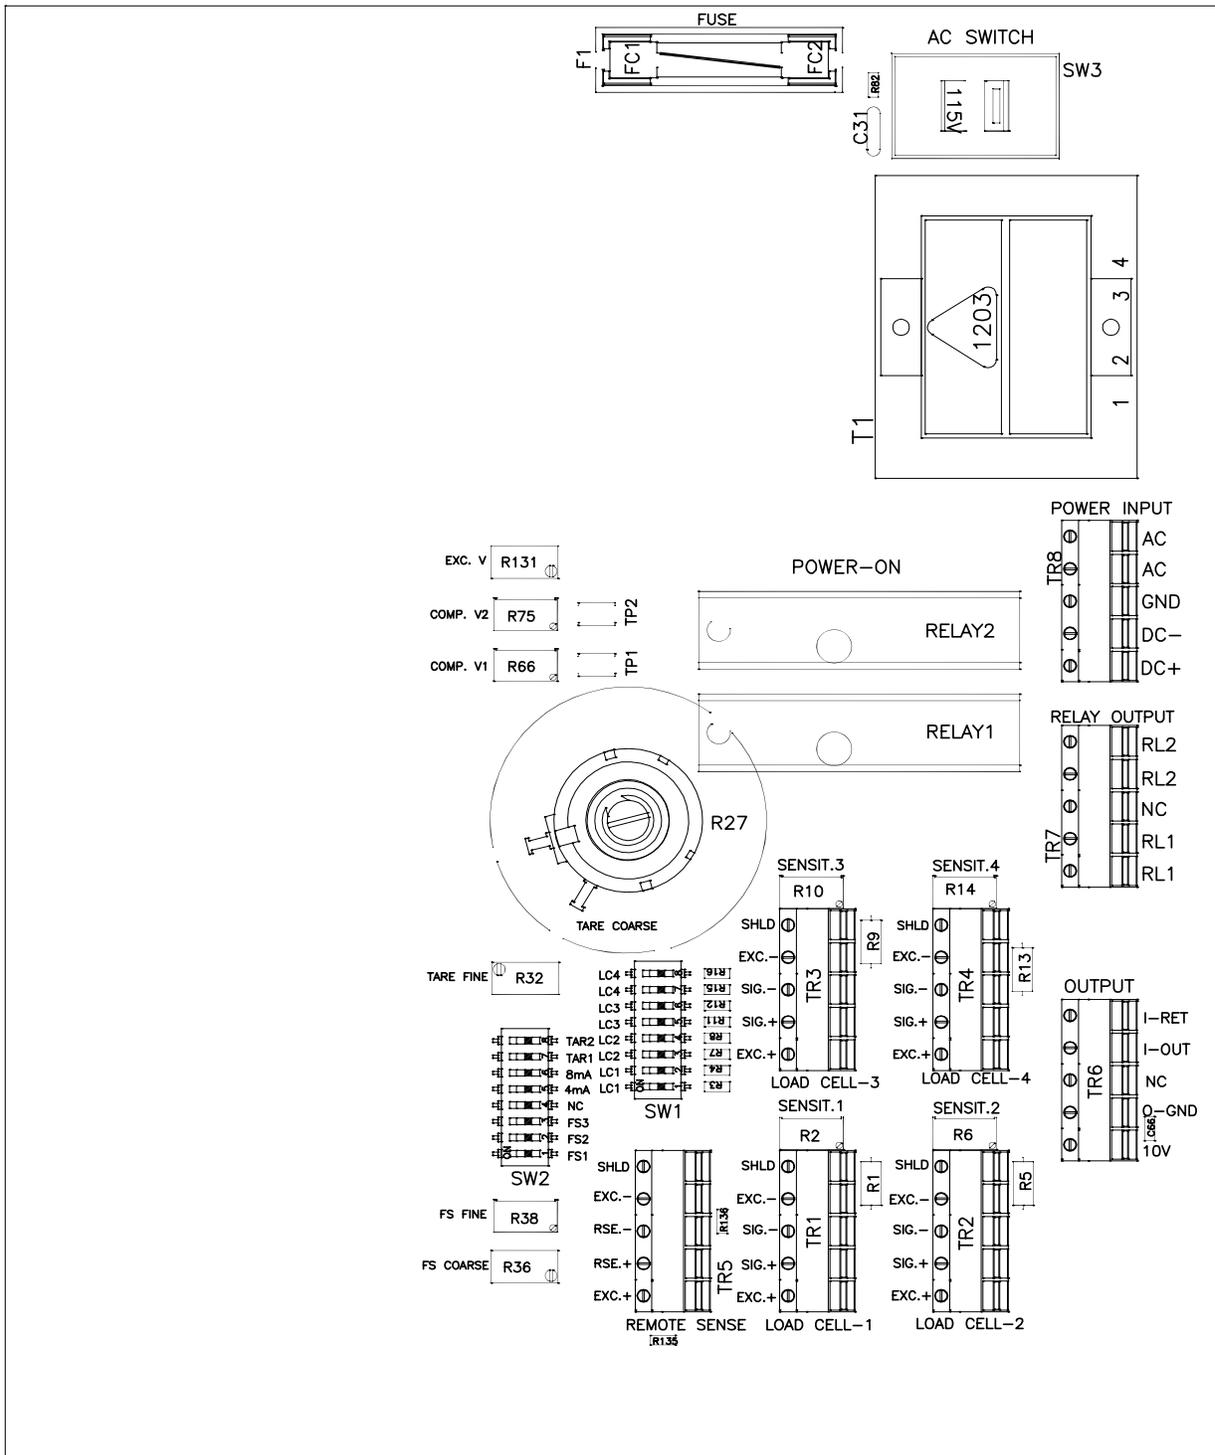

JBox-4800 Adjustment Locations
Relays 1 and 2 are installed by customer

II. INSTALLATION

1. Unpacking the JBox-4800
 - A. Item Check List
 - √ JBox-4800 Load Cell Summing Transmitter
 - √ AC Power Cord
 - √ Grounding Kit for NEMA 4 Box
 - √ Operation Manual
 - √ Hole Plugs

2. Mounting

Mount the NEMA 4 Box using four screws in a location where water will not drip or run directly onto it.

Connect the box to the scale frame work ground using the “Grounding Kit” and a low resistance ground strap (e.g. #10 or larger wire). A terminal “GND” on “Power Input” connector can also be used for ground connection.

3. Electrical Connection

Note: All the terminals are marked clearly on the printed circuit board. Be sure all terminal strip connections are tight and the cable conductors are not cut or damaged. Use strain relief connectors, tighten securely. Remove any unused strain reliefs and replace with provided hole plugs.

A. Connect the power to JBox-4800

If you use AC power line, connect the two AC power leads to “AC” pin and ground lead to “GND” pin. Set the “AC Switch” to your power line voltage (115V or 230V) before you plug in the power cord.

If you use DC power, connect the DC power supply plus lead to “DC+” pin and negative lead to “DC-” pin.

B. Pre-set the excitation voltage

Connect “RSE.+” (Remote sensing) to “EXC+” (Excitation), on “Remote Sense” connector “TR5”, and connect “RSE.-” to “EXC.-”.

Turn on the power to JBox-4800. Measure the voltage at the remote sensing pins. Adjust the excitation supply voltage with the “EXC. V” potentiometer “R131”.

This step is necessary to avoid overdriving the load cells.

Note that all four load cell connectors “TR1-4” use the same excitation supply in parallel, so the excitation supply voltage is always adjusted at “EXC. V” potentiometer “R131” regardless of the number of cells.

****CAUTION: Turn off the power!***

C. Connect the load cells to the JBox-4800

"EXC.+" and "EXC.-" pins see Fig. 1 to Fig. 3 for different applications.

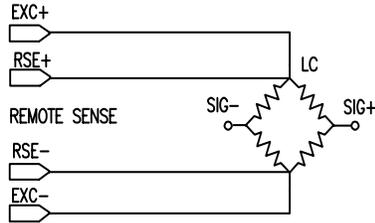


FIGURE 1.
Remote Sense for Single Load Cell

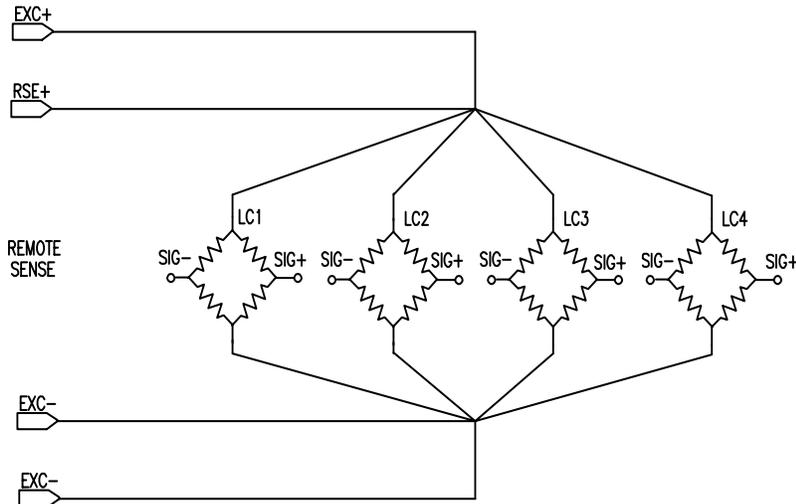


FIGURE 2.
Remote Sense for Multiple Load Cells

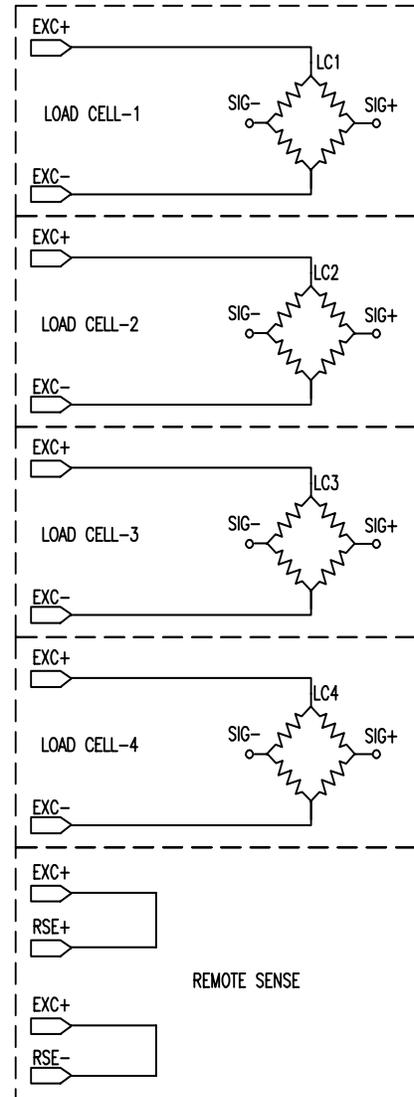


FIGURE 3.
Non-remote Sense for Multiple Load Cells

D. Remote Excitation

Excitation Supply is a high performance, remote sensing supply for long lead applications. Remote sensing mode is recommended for single load cell applications and also for up to four load cell applications where long leads are present.

The total voltage drop of excitation leads should be less than 1 V. An application example: if excitation leads are copper wire AWG no. 16, 1000 feet resistance is 4.016 ohm, round trip resistance is 8.032 ohm, then the voltage drop at 120 mA excitation current is less than 1 V.

If remote sensing is desired, disconnect "RSE.+" from "EXC.+", on "Remote Sense" connector "TR5", and disconnect "RSE.-" from "EXC.-"

Connect "RSE.+" and "RSE.-" to the excitation leads where you want the voltage to be controlled. Usually these two points are close to the load cell. See Fig. 2 for single load cell and Fig. 3 for multiple load cell connections.

If remote sensing is not used, skip step D.

E. Connect each load cell to the related amplifier input pins

"SIG.+" and "SIG.-" on connectors "Load Cell-1" to "Load Cell-4".

If a single load cell is used, connect it to "Load Cell-1" connector. (Other connectors "Load Cell-2 to 4" and switch "LC2 to 4" can also be used.)

All wires used in connecting up the JBox-4800 should be of the same material. If any intervening connections have to be made, such as a terminal block. The terminal block connecting points should have good thermal contact so they will always be at the same temperature to minimize thermal-electric effects.

F. "SW1" has eight dip switches for four load cells.

Turn on two switches "LC1" on "SW1". This connects the cell output signals to the amplifier input.

G. We strongly recommend you use the JBox4800 excitation supply to ensure high accuracy. In case the amplifier is used without the JBox-4800 excitation supply, the external power supply low side must be connected to the "EXC.-" terminal on "Remote Sense" connector.

III. Setup

1. Setting the Excitation Voltage

A. Turn on power to the JBox-4800

B. Measure the voltage at the remote sensing points or at the sense terminal on "Remote Sense" connector. Adjust the excitation supply voltage with the "EXC.V" potentiometer "R131".

2. Single Load Cell System Adjustment

A. Select the expected full scale signal range according to table 1 with SW2-"FS1", "FS2" and "FS3". If the output from the load cell is not known, set SW2 for the 40-50 mV range.

Table 1. Input Range Selection for Full Scale					
Range	0-20 mA / 0-10 V	2-10 V / 4-20 mA	FS1	FS2	FS3
1	5 to 10 mV	5 to 8 mV	OFF	OFF	OFF
2	10 to 20 mV	8 to 16 mV	OFF	OFF	ON
3	20 to 40 mV	16 to 32 mV	OFF	ON	ON or OFF
4	40 to 50 mV	32 to 50 mV	ON	ON or OFF	ON or OFF

B. Select Zero Output

Set SW2-"4mA" on for 4 mA or 2 V output or SW2-"4mA" off for 0 mA or 0 V output. Note actual output may not equal desired value, follow the steps below for adjustment.

C. Select Tare Range on “SW2” according to Table 2.

Table 2. Tare Range Selection		
	TARE 1	TARE 2
-3 to 6.5 mV	OFF	OFF
6.5 to 16 mV	OFF	ON
16 to 25 mV	ON	ON or OFF

D. Apply no load or dead weight to load cell.

E. For voltage output connect:

Connect the “Hi” lead of a digital voltmeter to the “10V”, connect the “Lo” lead of the digital voltmeter to the “O-GND” of “OUTPUT” connector “TR6”.

For current output: Connect the “Hi” lead of a current meter to the “I-OUT”, connect the “Lo” lead of the current meter to the current return terminal “I-RET” of “OUTPUT” connector “TR6”.

There will be a small difference between current output and voltage output. Select current or voltage output for adjustment.

F. Adjust “TARE COARSE” and “TARE FINE” potentiometers for the ZERO current (0 to 4 mA) or ZERO voltage (0 to 2 V).

G. Test signal: Turn on Switch “SW2”-“8mA” to output a change of 8 mA or 4 V for monitoring system check. See Table 3.

Table 3. Calibration Output Selection		
	“SW2” - “4 mA” OFF	“SW2” - “4mA” ON
“SW2” - “8 mA” OFF	0	4 mA and/or 2 V
“SW2” - “8 mA” ON	8 mA and/or 4 V	12 mA and/or 6 V

Turn “SW2”-“8mA” off, after the completion of system check

H. Apply rated load cell full scale load. Adjust “SENSIT.1” (“R2”) to get the maximum sensitivity.

I. Apply rated load cell full scale load. Adjust “FS COARSE” and “FS FINE” (GAIN) potentiometers for the desired full scale output voltage or current. Set full scale range switches as required in Table 2.

J. Remove full scale load and check ZERO output voltage or current. Adjust “TARE FINE” potentiometer if required.

K. Recheck full scale as in step 2.I.

3. Multiple Load Cells Adjustment (Cornering the scale)

Note: The full scale weight of a system with multiple load cells is the multiple of rated full scale of each load cell.

A. Turn on two “SW1”-“LC1” switches only, turn off other “SW1” switches.

Follow steps 2.A to 2.I. Note: Apply a load of 20 to 100% of the rated full scale capacity of each load cell (not the full scale of system) for corner adjustment. Record the output voltage with and without load.

- B.** Turn on two "SW1"-LCn" (n=2, 3 or 4) switches only, turn off all other "SW1" switches. Apply same load as in step 1. Adjust "SENSIT.n" to get the maximum sensitivity. Record the output voltages with and without load for each load cell.
- C.** Calculate the span, the difference of output voltage between no load and loaded for each corner load cell.

The sensitivity adjustment range for 350 ohm load cells is 7%. If the spread of the difference of output voltage between corner load cells is larger than 7%, check the mechanical installation of load cells and the specifications of load cells, Usually the corner load cells should be matched to each other within $\pm 3\%$.

- D.** Select the lowest cell output span as the span reference. Do not adjust the load cell sensitivity pot for this cell.

Turn on two "SW1"-LCn" (n=1, 2, 3 or 4) switches only. Turn off all other "SW1" switches. Apply no load and 20% to 100% of full scale of load cell (Not system full scale). Adjust "Sensit. n" potentiometer to lower down the sensitivity for the output span to be the same value as span reference voltage.

- E.** If there is no way to put known weight on each corner, apply 20 to 100% of full scale of system load instead of 20 to 100% of full scale of load cell. Then follow the steps A to D.
- F.** Turn on all "SW1"-LC1", "LC2"..."LCn" switches which are used. Remove all load and check ZERO output voltage or current. Adjust "TARE COARSE" and "TARE FINE" potentiometer for zero output.
- G.** Apply rated system full scale load. Adjust "FS COARSE" and "FS FINE" (GAIN) potentiometers for the desired full scale output voltage or current. Set full scale range switches as required in Table 2.
- H.** If necessary, repeat step 3.E and 3.F.

Note: Do not try to equalize the dead load outputs of each cell. The dead load does not need to be the same for proper operation of the summing board.

4. Troubleshooting

A. The scale seems to be reading incorrectly

- a. Check for correct wiring.
- b. Unload the scale and check for a zero reading.
- c. Check the input range switches according to Table 2.
- d. Be sure that the object being weighed is completely on the scale.

B. The scale corner readings are not equal

- a. Repeat step 3. Multiple load cells adjustment.
- b. Check the installation of load cells
- c. Check the load cells for damage.

C. The scale readings drift rapidly

- a. Check for water in the junction box.
- b. Isolate one load cell at a time from the summing box by turning off the two related switches "LCn" (n=1 to 4). If the scale reading becomes stable, then the isolated load cell is probably defective or not installed properly.
- c. Use a load cell simulator to verify that the JBox-4800 is stable and operating correctly.

D. Test the load cell zero shift

- a. Remove the load from the load cell.
- b. Turn on the two related switches "LCn", turn off all other switches.
- c. Measure the output voltage on "output: connector. If it is less than 15% of full scale output, it is not zero shifted. If the output is 15 to 50% of full scale, the load cell has bene zero shifted, but will probably still work. If the output is larger than 50% of full scale, the load cell should be replaced with a known good unit. If the zero shift of the load cell is caused by a mechanical overload, the reason for the overload should be determined before a new load cell is installed.

E. Test load cell resistance

- a. Disconnect the load cells from the junction box.
- b. Measure the resistances of load cell and compare to the load cell specifications. Water leakage into the load cell or damaged cable can cause problems.
- c. If a load cell does not pass the resistance test, replace it with a know good unit.
- d. Defective load cells can usually be repaired.

IV. OPTIONS

1. Enclosures

JBox-4800: Continuous Hinge NEMA 4 Box

2. Dual Set Point Relays

A. Opto-22 G4ODC5 *

Opto-22 G4OAC5 *

*Not included with the JBox-4800

B. Installation

Plug the Opto-22 output modules into "RELAY1 and "RELAY2" on the printed circuit board.
Tighten the screw on top of the module lightly.

C. Adjusting Set Point Values

If you need the Relay outputs, connect the "Hi" lead of a digital voltmeter to the "TP1". Connect the "Lo" lead of the digital voltmeter to the "O-GND" on "OUTPUT" connector "TR6". Test the voltage at "TP1" and adjust the "COMP. V1" potentiometer "R66" to set the Comparator voltage for the low set point. If the output voltage at "OUTPUT" connector "TR6" is lower than the Comparator voltage at "TP1", this means the output is lower than the low set point, and the output of Relay 1 will be "ON". The two "RL1" on "RELAY OUTPUT" connector "TR7" are the Opto-22 Output contacts.

Use the digital voltmeter to set the voltage at "TP2" with "COMP.V2" potentiometer "R75" for high set point. If the output voltage at "OUTPUT" on connector "TR6" is higher than the Comparator voltage at "TP2", this means the output is higher than high set pint, and the output of Relay 2 will be "ON". The two "RL2" on "RELAY OUTPUT" connector "TR7" are the Opto-22 Output contacts.

In order to prevent relay chatter, typically there are 0.07 V hysteresis voltage. There may be a very small difference between the output voltage and the voltage at "TP1" or "TP2" for turn on or off. The output voltage for turn on or off can be set precisely by adjusting the "COMP.V1" potentiometer "R66" for the low set point or 'COMP.V2" potentiometer "R75" for high set point.

WARRANTY/DISCLAIMER

OMEGA ENGINEERING, INC. warrants this unit to be free of defects in materials and workmanship for a period of **13 months** from date of purchase. OMEGA's WARRANTY adds an additional one (1) month grace period to the normal **one (1) year product warranty** to cover handling and shipping time. This ensures that OMEGA's customers receive maximum coverage on each product.

If the unit malfunctions, it must be returned to the factory for evaluation. OMEGA's Customer Service Department will issue an Authorized Return (AR) number immediately upon phone or written request. Upon examination by OMEGA, if the unit is found to be defective, it will be repaired or replaced at no charge. OMEGA's WARRANTY does not apply to defects resulting from any action of the purchaser, including but not limited to mishandling, improper interfacing, operation outside of design limits, improper repair, or unauthorized modification. This WARRANTY is VOID if the unit shows evidence of having been tampered with or shows evidence of having been damaged as a result of excessive corrosion; or current, heat, moisture or vibration; improper specification; misapplication; misuse or other operating conditions outside of OMEGA's control. Components in which wear is not warranted, include but are not limited to contact points, fuses, and triacs.

OMEGA is pleased to offer suggestions on the use of its various products. However, OMEGA neither assumes responsibility for any omissions or errors nor assumes liability for any damages that result from the use of its products in accordance with information provided by OMEGA, either verbal or written. OMEGA warrants only that the parts manufactured by the company will be as specified and free of defects. OMEGA MAKES NO OTHER WARRANTIES OR REPRESENTATIONS OF ANY KIND WHATSOEVER, EXPRESSED OR IMPLIED, EXCEPT THAT OF TITLE, AND ALL IMPLIED WARRANTIES INCLUDING ANY WARRANTY OF MERCHANTABILITY AND FITNESS FOR A PARTICULAR PURPOSE ARE HEREBY DISCLAIMED. LIMITATION OF LIABILITY: The remedies of purchaser set forth herein are exclusive, and the total liability of OMEGA with respect to this order, whether based on contract, warranty, negligence, indemnification, strict liability or otherwise, shall not exceed the purchase price of the component upon which liability is based. In no event shall OMEGA be liable for consequential, incidental or special damages.

CONDITIONS: Equipment sold by OMEGA is not intended to be used, nor shall it be used: (1) as a "Basic Component" under 10 CFR 21 (NRC), used in or with any nuclear installation or activity; or (2) in medical applications or used on humans. Should any Product(s) be used in or with any nuclear installation or activity, medical application, used on humans, or misused in any way, OMEGA assumes no responsibility as set forth in our basic WARRANTY/DISCLAIMER language, and, additionally, purchaser will indemnify OMEGA and hold OMEGA harmless from any liability or damage whatsoever arising out of the use of the Product(s) in such a manner.

RETURN REQUESTS/INQUIRIES

Direct all warranty and repair requests/inquiries to the OMEGA Customer Service Department. BEFORE RETURNING ANY PRODUCT(S) TO OMEGA, PURCHASER MUST OBTAIN AN AUTHORIZED RETURN (AR) NUMBER FROM OMEGA'S CUSTOMER SERVICE DEPARTMENT (IN ORDER TO AVOID PROCESSING DELAYS). The assigned AR number should then be marked on the outside of the return package and on any correspondence.

The purchaser is responsible for shipping charges, freight, insurance and proper packaging to prevent breakage in transit.

FOR **WARRANTY** RETURNS, please have the following information available BEFORE contacting OMEGA:

1. Purchase Order number under which the product was PURCHASED,
2. Model and serial number of the product under warranty, and
3. Repair instructions and/or specific problems relative to the product.

FOR **NON-WARRANTY** REPAIRS, consult OMEGA for current repair charges. Have the following information available BEFORE contacting OMEGA:

1. Purchase Order number to cover the COST of the repair,
2. Model and serial number of the product, and
3. Repair instructions and/or specific problems relative to the product.

OMEGA's policy is to make running changes, not model changes, whenever an improvement is possible. This affords our customers the latest in technology and engineering.

OMEGA is a registered trademark of OMEGA ENGINEERING, INC.

© Copyright 2011 OMEGA ENGINEERING, INC. All rights reserved. This document may not be copied, photocopied, reproduced, translated, or reduced to any electronic medium or machine-readable form, in whole or in part, without the prior written consent of OMEGA ENGINEERING, INC.

Where Do I Find Everything I Need for Process Measurement and Control? **OMEGA...Of Course!** *Shop online at omega.comSM*

TEMPERATURE

- ☑ Thermocouple, RTD & Thermistor Probes, Connectors, Panels & Assemblies
- ☑ Wire: Thermocouple, RTD & Thermistor
- ☑ Calibrators & Ice Point References
- ☑ Recorders, Controllers & Process Monitors
- ☑ Infrared Pyrometers

PRESSURE, STRAIN AND FORCE

- ☑ Transducers & Strain Gages
- ☑ Load Cells & Pressure Gages
- ☑ Displacement Transducers
- ☑ Instrumentation & Accessories

FLOW/LEVEL

- ☑ Rotameters, Gas Mass Flowmeters & Flow Computers
- ☑ Air Velocity Indicators
- ☑ Turbine/Paddlewheel Systems
- ☑ Totalizers & Batch Controllers

pH/CONDUCTIVITY

- ☑ pH Electrodes, Testers & Accessories
- ☑ Benchtop/Laboratory Meters
- ☑ Controllers, Calibrators, Simulators & Pumps
- ☑ Industrial pH & Conductivity Equipment

DATA ACQUISITION

- ☑ Data Acquisition & Engineering Software
- ☑ Communications-Based Acquisition Systems
- ☑ Plug-in Cards for Apple, IBM & Compatibles
- ☑ Data Logging Systems
- ☑ Recorders, Printers & Plotters

HEATERS

- ☑ Heating Cable
- ☑ Cartridge & Strip Heaters
- ☑ Immersion & Band Heaters
- ☑ Flexible Heaters
- ☑ Laboratory Heaters

ENVIRONMENTAL MONITORING AND CONTROL

- ☑ Metering & Control Instrumentation
- ☑ Refractometers
- ☑ Pumps & Tubing
- ☑ Air, Soil & Water Monitors
- ☑ Industrial Water & Wastewater Treatment
- ☑ pH, Conductivity & Dissolved Oxygen Instruments