

**1 YEAR**  
WARRANTY

# **Ω OMEGA™** **User's Guide**



**Shop online at**  
***omega.com™***

***e-mail: info@omega.com***  
***For latest product manuals:***  
***www.omegamanual.info***

**EWS-RH**  
**Relative Humidity/Temperature**  
**Transmitter**



omega.com info@omega.com

U.S.A.:

**Servicing North America:**

Omega Engineering, Inc.

Toll-Free: 1-800-826-6342 (USA & Canada only)

Customer Service: 1-800-622-2378 (USA & Canada only)

Engineering Service: 1-800-872-9436 (USA & Canada only)

Tel: (203) 359-1660

e-mail: info@omega.com

Fax: (203) 359-7700

**For Other Locations Visit [omega.com/worldwide](http://omega.com/worldwide)**

---

The information contained in this document is believed to be correct, but OMEGA accepts no liability for any errors it contains, and reserves the right to alter specifications without notice.

**WARNING:** These products are not designed for use in, and should not be used for, human applications.

---

	<b>Page</b>
General Description .....	1
Unpacking .....	1
Theory of Operation .....	1
Mounting .....	3
RH/Temperature Calculations .....	5
Calibration .....	6
Relative Humidity Calibration Procedure .....	6
Temperature Calibration Procedure .....	7
Specifications .....	8

<b>Figure</b>	<b>Page</b>
Figure 1A Mounting Diagram .....	3
Figure 1B EWS-MB Dimensions .....	4
Figure 2 Transmitter Wiring Examples For Current Output ...	4
Figure 3 Transmitter Wiring Examples For Voltage Output ...	4
Figure 4 Relative Humidity Calibration Procedure .....	6
Figure 5 Temperature Calibration Procedure.....	7

# EWS-RH Relative Humidity/Temperature Transmitter

---



## General Description

The OMEGA® Model EWS-RH is a combination dual output, relative humidity/temperature transmitter. A thin film temperature compensated, polymer capacitor senses relative humidity while a solid state temperature sensor measures ambient temperature. Independent user selectable 4-20 mA or 1-5 Vdc outputs are provided for both measured parameters via a terminal strip connection.

## Unpacking

Remove the packing list and verify that you have received all your equipment. If you have any questions about the shipment, please call our Customer Service Department at

1-800-622-2378 or 203-359-1660. On the web you can find us at:  
[www.omega.com](http://www.omega.com) e-mail: [cservice@omega.com](mailto:cservice@omega.com)

When you receive the shipment, inspect the container and equipment for any signs of damage. Note any evidence of rough handling in transit. Immediately report any damage to the shipping agent.

---

### NOTE

---

The carrier will not honor any damage claims unless all shipping material is saved for inspection. After examining and removing contents, save packing material and carton in the event reshipment is necessary.

---

The following items are supplied in the box with your transmitter.

This Manual, # M-3501	(1 ea.)
Dewpoint Card	(1 ea.)
#6 Wall Anchor	(2 ea.)
#6 Mounting Screw	(2 ea.)



### **Additional EWS Series Models Available**

<b>Model</b>	<b>Description</b>
EWS-TC-(* )	Wall mount thermocouple sensor (* = insert type, J, K, T, E)
EWS-RTD	Wall mount RTD sensor (1002 Pt., .00385)
EWS-TX	Wall mount solid state temperature transmitter
EWS-BP-A	Wall mount barometric pressure transmitter

### **Theory of Operation**

A 4-20 mA loop is a series loop in which a transmitter will vary the current flow depending on the input to the transmitter. In the EWS-RH the amount of current allowed to flow in the loop will vary depending on the relative humidity or temperature being measured by the sensor. Some advantages of a current output over a voltage output is that the signal measured is less susceptible to electrical noise interference and the loop can support more than one measuring instrument as long as the maximum loop resistance is not exceeded.

A typical application utilizing a current loop will normally consist of a power supply, the transmitter and a meter, recorder or controller to measure the current flow. The loop resistance is the sum of the measuring instruments and wire used. The maximum allowable loop resistance for the EWS-RH to function properly is found by using the following formula:

$$R_{\max} = (\text{power supply voltage} - 8 \text{ volts}) / .02 \text{ amps}$$

For applications that require a voltage output signal the EWS-RH has a built-in 250 Ohm shunt resistor that will convert the transmitters output to a 1-5 Vdc signal when wired correctly. See *“Transmitter Wiring Examples”* in this manual.

### **Recommended Accessories**

Power Supply, OMEGA® Part No.: PSU-93

Shielded 4-conductor cable, OMEGA® Part No.: TX4-100

Conduit Box Mounting Kit, OMEGA® Part No.: EWS-MB



**NOTE**

These units are not designed, nor recommended for medical, Explosive Environment or outdoor applications.

## Mounting

OMEGA's EWS Series of sensors and transmitters are designed for wall mounting in locations that are free from dirt, grease, food particles and condensing moisture such as manufacturing clean rooms, computer rooms and laboratory type environments. Plastic wall anchors and mounting screws are included for mounting to standard wallboard. A conduit box mounting bracket/wall plate adapter kit is also available as an option that will allow the transmitter to be mounted to a standard electrical conduit box.

Order OMEGA® Model No.: EWS-MB.

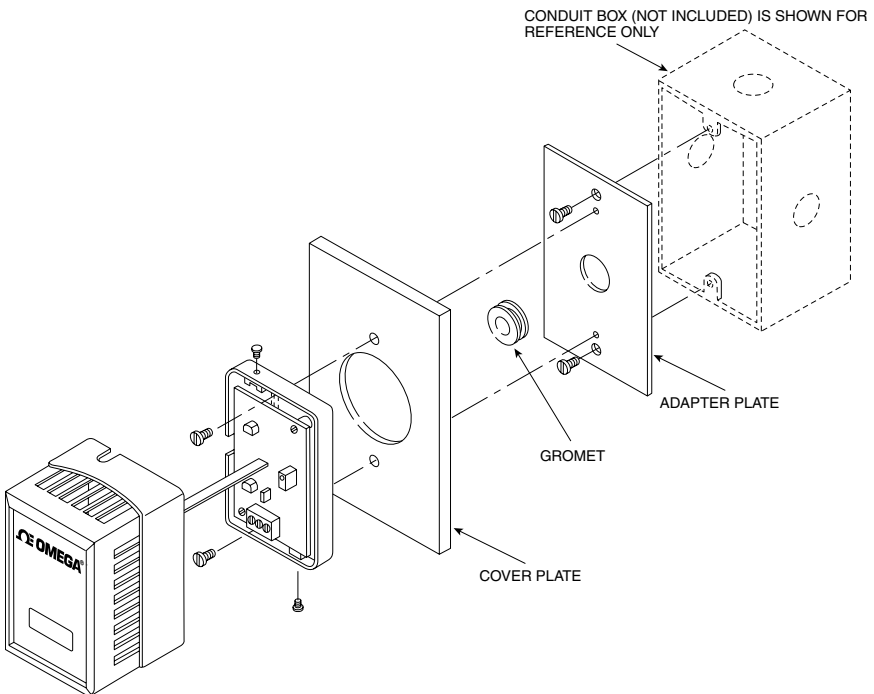


Figure 1A. Mounting Diagram



**EWS-RH**  
**Relative Humidity/Temperature Transmitter**

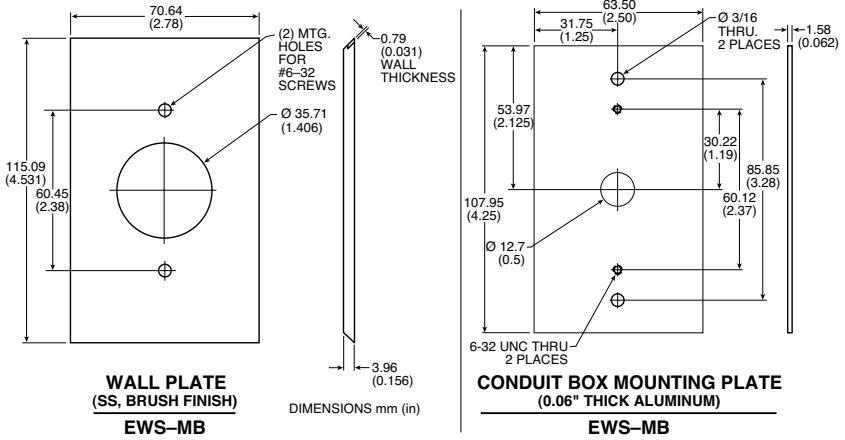


Figure 1B. EWS-MB Dimensions

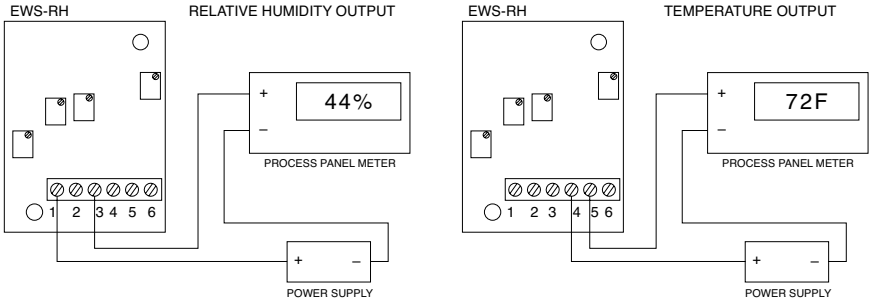


Figure 2. Transmitter Wiring Examples For Current Output (4-20 mA)

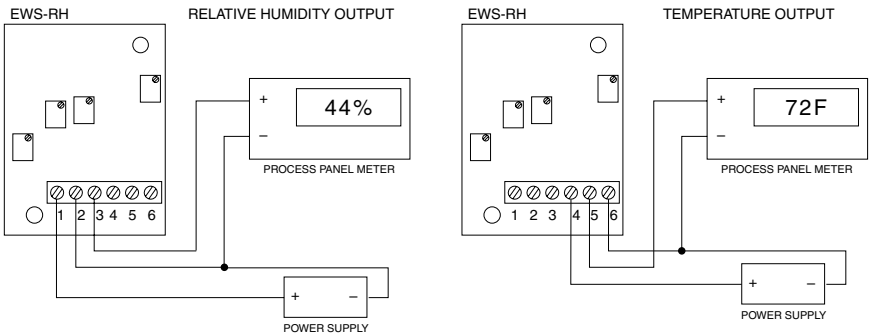


Figure 3. Transmitter Wiring Examples For Voltage Output (1-5 Vdc)





## RH/Temperature Calculations

To calculate % Relative Humidity by measuring current output in milliamperes.

$$\left( \frac{\text{Current output} - 4}{.16} \right) = \% \text{ RH}$$

To calculate Temperature by measuring current output in milliamperes.

$$\left( \frac{\text{Current output} - 4}{.16} \times 135 \right) + 5 = \text{Temp } (^\circ\text{F})$$

RH Measured Vs Output Reading

% Relative Humidity	Output	
	Current(mA)	Voltage(Vdc)
5	4.8	1.2
10	5.6	1.4
15	6.4	1.6
20	7.2	1.8
25	8	2
30	8.8	2.2
35	9.6	2.4
40	10.4	2.6
45	11.2	2.8
50	12	3
55	12.8	3.2
60	13.6	3.4
65	14.4	3.6
70	15.2	3.8
75	16	4
80	16.8	4.2
85	17.6	4.4
90	18.4	4.6
95	19.2	4.8

Temperature Measured Vs Output Reading

Temperature °C (°F)	Output	
	Current(mA)	Voltage(Vdc)
-15 (5)	4	1
-10 (14)	5.07	1.27
0 (32)	7.20	1.80
10 (50)	9.33	2.33
20 (72)	11.94	2.99
30 (86)	13.60	3.40
40 (104)	15.73	3.93
50 (122)	17.87	4.47
60 (140)	20	5



## Calibration

Your transmitter has been factory calibrated to meet or exceed the specifications outlined in this manual. To maintain original specifications it is generally recommended that your transmitter be re-calibrated on an annual basis depending on operating conditions.

## Relative Humidity Calibration Procedure

Recommended equipment:

Humidity Generator/Calibrator Kit, OMEGA® Model No.: RHCL-KIT  
Handheld Digital Multimeter, OMEGA® Model No.: HHM29

### NOTE

Do not make adjustments to potentiometer "P3", this is a factory setting and is not field adjustable. If "P3" is disturbed the transmitter will need to be returned to the factory for service.

1. Remove enclosure cover
2. Connect transmitter as shown in figure below.
3. Apply power to transmitter and allow to warm up for 15 min.
4. Place sensor in a 20% RH environment and allow to stabilize for 20 min.
5. Adjust potentiometer "P1" for a output reading of 7.2 mA
6. Place sensor in a 80% RH environment and allow to stabilize for 20 min.
7. Adjust potentiometer "P2" for an output reading of 16.8 mA
8. Repeat steps 4, 5, 6, 7 as necessary until proper readings are maintained.
9. Calibration complete.

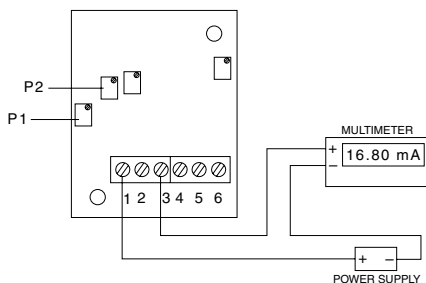


Figure 4. Relative Humidity Calibration Procedure



## Temperature Calibration Procedure

### Recommended equipment:

Series 860 Thermistor Meter OMEGA® Model No. 865F or 865C  
Series 400 Thermistor Probe, OMEGA® Model No.: ON-406-PP  
Handheld Digital Multimeter, OMEGA® Model No.: HHM29

1. Remove enclosure cover.
2. Connect transmitter as shown in figure below.
3. Apply power to transmitter and allow to warm up for 10 min.
4. Place unit on workbench with temperature reference probe next to unit.
5. Allow output from transmitter and reference probe to stabilize.
6. Observe the reading on the handheld thermometer coming from the reference probe.
7. Without touching the unit with your hand, adjust potentiometer "P4" for a current output of the transmitter that matches the temperature measured by the reference probe. Note: if you hold the unit with your hand, the unit will sense heat from your hand and cause a bad calibration.

### Use this formula:

$$\left( \frac{\text{Ambient} - 5}{135} \times 16 \right) + 4$$

### Example:

If your reference probe measures 70°F (21.11°C) you need to adjust the transmitter's current output to be 11.70 mA.

8. Calibration complete.

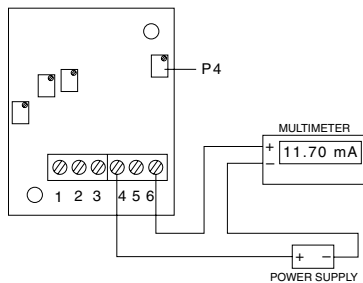


Figure 5. Temperature Calibration Procedure



**Relative Humidity Specifications**

Range:	5-95% (non-condensing)
Accuracy @ 25°C:	From 5-20%, ± 4% RH From 20-80%, ± 3% RH From 80-95%, ± 4% RH
Repeatability:	± 1% RH
Temp. Compensation Range:	5 to 140°F (-15 to 60°C)
Output:	4-20 mA or 1-5 Vdc (scaled for 0 to 100% RH)
Power:	12-24 Vdc @ 20mA
Max Loop Resistance:	Ohms = (V supply - 8V)/.02 A
RH Time Constant:	100 sec., from 20-90%, 60 sec from 90-20%
Sensor Type:	Thin Film Polymer Capacitor

**Temperature Specifications**

Range:	5 to 140°F (-15 to 60°C)
Accuracy @ 25°C	
In Still Air:	± 1.2°F (0.7°C) @ 25°C ± 2.5°F (1.4°C) across full range
In Moving Air:	± 2.5°F (1.4°C) @ 25°C ± 3°F (1.7°C) across full range

**Note: Not recommended for fast moving air applications.**

Repeatability:	± 0.5°F (0.3°C)
Output :	4-20 mA or 1-5 Vdc (scaled across range)
Temp. Time Constant:	(for 63.2% response) 9 sec. in moving air (1 M/sec.), 30 sec. in still air
Power:	12-24 Vdc @ 20 mA
Max Loop Resistance:	Ohms = (V supply - 8V)/.02 A
Sensor Type:	Solid State

**General Specifications**

Enclosure Material:	Acrylonitrile Butadiene
Dimensions:	79 x 54 x 45mm (3.12 L x 2.12 W x 1.78" H)
Weight:	54 g (.12 lb)



**NOTES:**



**EWS-RH**

**Relative Humidity/Temperature Transmitter**

---

**NOTES:**

## WARRANTY/DISCLAIMER

OMEGA ENGINEERING, INC. warrants this unit to be free of defects in materials and workmanship for a period of **13 months** from date of purchase. OMEGA's WARRANTY adds an additional one (1) month grace period to the normal **one (1) year product warranty** to cover handling and shipping time. This ensures that OMEGA's customers receive maximum coverage on each product.

If the unit malfunctions, it must be returned to the factory for evaluation. OMEGA's Customer Service Department will issue an Authorized Return (AR) number immediately upon phone or written request. Upon examination by OMEGA, if the unit is found to be defective, it will be repaired or replaced at no charge. OMEGA's WARRANTY does not apply to defects resulting from any action of the purchaser, including but not limited to mishandling, improper interfacing, operation outside of design limits, improper repair, or unauthorized modification. This WARRANTY is VOID if the unit shows evidence of having been tampered with or shows evidence of having been damaged as a result of excessive corrosion; or current, heat, moisture or vibration; improper specification; misapplication; misuse or other operating conditions outside of OMEGA's control. Components in which wear is not warranted, include but are not limited to contact points, fuses, and triacs.

**OMEGA is pleased to offer suggestions on the use of its various products. However, OMEGA neither assumes responsibility for any omissions or errors nor assumes liability for any damages that result from the use of its products in accordance with information provided by OMEGA, either verbal or written. OMEGA warrants only that the parts manufactured by the company will be as specified and free of defects. OMEGA MAKES NO OTHER WARRANTIES OR REPRESENTATIONS OF ANY KIND WHATSOEVER, EXPRESSED OR IMPLIED, EXCEPT THAT OF TITLE, AND ALL IMPLIED WARRANTIES INCLUDING ANY WARRANTY OF MERCHANTABILITY AND FITNESS FOR A PARTICULAR PURPOSE ARE HEREBY DISCLAIMED. LIMITATION OF LIABILITY: The remedies of purchaser set forth herein are exclusive, and the total liability of OMEGA with respect to this order, whether based on contract, warranty, negligence, indemnification, strict liability or otherwise, shall not exceed the purchase price of the component upon which liability is based. In no event shall OMEGA be liable for consequential, incidental or special damages.**

CONDITIONS: Equipment sold by OMEGA is not intended to be used, nor shall it be used: (1) as a "Basic Component" under 10 CFR 21 (NRC), used in or with any nuclear installation or activity; or (2) in medical applications or used on humans. Should any Product(s) be used in or with any nuclear installation or activity, medical application, used on humans, or misused in any way, OMEGA assumes no responsibility as set forth in our basic WARRANTY/DISCLAIMER language, and, additionally, purchaser will indemnify OMEGA and hold OMEGA harmless from any liability or damage whatsoever arising out of the use of the Product(s) in such a manner.

## RETURN REQUESTS/INQUIRIES

Direct all warranty and repair requests/inquiries to the OMEGA Customer Service Department. BEFORE RETURNING ANY PRODUCT(S) TO OMEGA, PURCHASER MUST OBTAIN AN AUTHORIZED RETURN (AR) NUMBER FROM OMEGA'S CUSTOMER SERVICE DEPARTMENT (IN ORDER TO AVOID PROCESSING DELAYS). The assigned AR number should then be marked on the outside of the return package and on any correspondence.

The purchaser is responsible for shipping charges, freight, insurance and proper packaging to prevent breakage in transit.

FOR **WARRANTY** RETURNS, please have the following information available BEFORE contacting OMEGA:

1. Purchase Order number under which the product was PURCHASED,
2. Model and serial number of the product under warranty, and
3. Repair instructions and/or specific problems relative to the product.

FOR **NON-WARRANTY** REPAIRS, consult OMEGA for current repair charges. Have the following information available BEFORE contacting OMEGA:

1. Purchase Order number to cover the COST of the repair,
2. Model and serial number of the product, and
3. Repair instructions and/or specific problems relative to the product.

OMEGA's policy is to make running changes, not model changes, whenever an improvement is possible. This affords our customers the latest in technology and engineering.

OMEGA is a registered trademark of OMEGA ENGINEERING, INC.

© Copyright 2014 OMEGA ENGINEERING, INC. All rights reserved. This document may not be copied, photocopied, reproduced, translated, or reduced to any electronic medium or machine-readable form, in whole or in part, without the prior written consent of OMEGA ENGINEERING, INC.

# Where Do I Find Everything I Need for Process Measurement and Control? **OMEGA...Of Course!** *Shop online at [omega.com](http://omega.com)™*

## **TEMPERATURE**

- ☑ Thermocouple, RTD & Thermistor Probes, Connectors, Panels & Assemblies
- ☑ Wire: Thermocouple, RTD & Thermistor
- ☑ Calibrators & Ice Point References
- ☑ Recorders, Controllers & Process Monitors
- ☑ Infrared Pyrometers

## **PRESSURE, STRAIN AND FORCE**

- ☑ Transducers & Strain Gages
- ☑ Load Cells & Pressure Gages
- ☑ Displacement Transducers
- ☑ Instrumentation & Accessories

## **FLOW/LEVEL**

- ☑ Rotameters, Gas Mass Flowmeters & Flow Computers
- ☑ Air Velocity Indicators
- ☑ Turbine/Paddlewheel Systems
- ☑ Totalizers & Batch Controllers

## **pH/CONDUCTIVITY**

- ☑ pH Electrodes, Testers & Accessories
- ☑ Benchtop/Laboratory Meters
- ☑ Controllers, Calibrators, Simulators & Pumps
- ☑ Industrial pH & Conductivity Equipment

## **DATA ACQUISITION**

- ☑ Data Acquisition & Engineering Software
- ☑ Communications-Based Acquisition Systems
- ☑ Plug-in Cards for Apple, IBM & Compatibles
- ☑ Data Logging Systems
- ☑ Recorders, Printers & Plotters

## **HEATERS**

- ☑ Heating Cable
- ☑ Cartridge & Strip Heaters
- ☑ Immersion & Band Heaters
- ☑ Flexible Heaters
- ☑ Laboratory Heaters

## **ENVIRONMENTAL MONITORING AND CONTROL**

- ☑ Metering & Control Instrumentation
- ☑ Refractometers
- ☑ Pumps & Tubing
- ☑ Air, Soil & Water Monitors
- ☑ Industrial Water & Wastewater Treatment
- ☑ pH, Conductivity & Dissolved Oxygen Instruments