

1 YEAR
WARRANTY

MADE IN
USA

CE



User's Guide



Shop online at

omega.com[®]

Ω OMEGA[®]

omega.com

e-mail: info@omega.com

For latest product manuals:

omegamanual.info

ISO 9001
CERTIFIED
CORPORATE QUALITY

STAMFORD, CT

ISO 9001
CERTIFIED
CORPORATE QUALITY

MANCHESTER, UK

HHP242 SERIES Digital Manometer



OMEGAnet® On-Line Service
omega.com

Internet e-mail
info@omega.com

Servicing North America:

U.S.A.:
ISO 9001 Certified

OMEGA Engineering, Inc.
One Omega Drive, P.O. Box 4047
Stamford, CT 06907-0047 USA
Toll-Free: 1-800-826-6342 TEL: (203) 359-1660
FAX: (203) 359-7700 e-mail: info@omega.com

Canada:

976 Bergar
Laval (Quebec), Canada H7L 5A1
Toll-Free: 1-800-826-6342 TEL: (514) 856-6928
FAX: (514) 856-6886 e-mail: info@omega.ca

For immediate technical or application assistance:

**U.S.A. and
Canada:**

Sales Service: 1-800-826-6342/1-800-TC-OMEGA®
Customer Service: 1-800-622-2378/1-800-622-BEST®
Engineering Service: 1-800-872-9436/1-800-USA-WHEN®

Mexico:

En Español: 001 (203) 359-7803 FAX: (001) 203-359-7807
info@omega.com.mx e-mail: espanol@omega.com

Servicing Europe:

Benelux:

Managed by the United Kingdom Office
Toll-Free: 0800 099 3344 TEL: +31 20 347 21 21
FAX: +31 20 643 46 43 e-mail: sales@omega.nl

Czech Republic:

Frystatska 184
733 01 Karviná, Czech Republic
Toll-Free: 0800-1-66342 TEL: +420-59-6311899
FAX: +420-59-6311114 e-mail: info@omegashop.cz

France:

Managed by the United Kingdom Office
Toll-Free: 0800 466 342 TEL: +33 (0) 161 37 29 00
FAX: +33 (0) 130 57 54 27 e-mail: sales@omega.fr

**Germany/
Austria:**

Daimlerstrasse 26
D-75392 Deckenpfronn, Germany
Toll-Free: 0 800 6397678 TEL: +49 (0) 7059 9398-0
FAX: +49 (0) 7056 9398-29 e-mail: info@omega.de

United Kingdom:

ISO 9001 Certified

OMEGA Engineering Ltd.
One Omega Drive, River Bend Technology Centre
Northbank, Irlam, Manchester M44 5BD England
Toll-Free: 0800-488-488 TEL: +44 (0)161 777-6611
FAX: +44 (0)161 777-6622 e-mail: sales@omega.co.uk

It is the policy of OMEGA Engineering, Inc. to comply with all worldwide safety and EMC/EMI regulations that apply. OMEGA is constantly pursuing certification of its products to the European New Approach Directives. OMEGA will add the CE mark to every appropriate device upon certification.

The information contained in this document is believed to be correct, but OMEGA accepts no liability for any errors it contains, and reserves the right to alter specifications without notice.

WARNING: These products are not designed for use in, and should not be used for, human applications.

PRESSURE CALIBRATOR USER MANUAL



This Pressure Calibrator instrument is a microcontroller based pressure sensing device that can be used to directly measure pressure. Differential, Gauge and Absolute pressure sensors are supported up to 100 PSI. Pressure can be displayed in selectable engineering units of PSI, bar, mbar, kPa, mmHg, inHg, mmH₂O or inH₂O.

Table of Contents

Introduction	3
User Interface.....	4
Single Keypad Functions	4
ON/OFF (O) Key	4
BACKLIGHT (B) Key	4
FUNC (F) Key	4
UNIT (U) Key.....	4
Zeroing the PC	5
Set Functional Mode.....	5
Liquid Crystal Display (LCD)	7
Engineering Units Select.....	8
Record Mode.....	9
Auto Shut-Off	10
Field Recalibration.....	11
ZERO	11
SPAN	12
Restore Factory Defaults.....	12
Specifications.....	13
Certification/Safety/Warnings	15
Changing the Batteries.....	15
User Connections.....	17
Contact Information.....	18

Introduction

Thank you for purchasing this Pressure Calibrator (PC) product.

The PC has been designed using the latest technology to provide reliable accuracy throughout its entire operating temperature range, dependable operation, and exceptional battery life.

The compact design makes the unit easy to carry and the intuitive user interface makes it easy to use.

Pressure measurements are displayed on a large, easy-to-read liquid crystal display (LCD). This unit has two backlights: a green backlight which is user activated, and an automatic red backlight which indicates an error/over range condition.

Four keys provide direct access to frequently used functions (like Units, Backlight). Other, less frequently used functions (like Zero, Span, and Record) are accessible via multiple key combinations. A complete list of these functions is printed on the back of the case.

User Interface



Single Keypad Functions

ON/OFF (O) Key

The ON/OFF key, represented by the standard ON/OFF symbol, turns the PC ON or OFF (note: the ON/OFF key must be held until the display turns on or off). Upon power on, the PC will perform a self test, display all segments for approximately 1-2 seconds, then go into the normal pressure measure mode using the last pressure units selected.

To view the calibrated accuracy and firmware revision, press and hold the ON/OFF key for approximately 2 seconds upon power on. The display will alternate between the calibrated accuracy and firmware revision for as long as the ON/OFF key is held.

BACKLIGHT (B) Key

The BACKLIGHT key, represented by the standard light-bulb symbol, turns the green display backlight on and off. The backlight will remain on for approximately 20 seconds if not manually turned off. To temporarily override the auto shut off feature, press and hold the BACKLIGHT key for approximately 2 seconds (until the backlight turns on-off-on).

FUNC (F) Key

This key selects the functional mode of the PC. There are 5 functional modes: NORMAL (pressure measure), HOLD, MIN/MAX, AVE and TEMP. Pressing FUNC repeatedly will cycle through these modes in the order listed. Since HOLD is first in the sequence, measurements can be readily captured as needed.

UNIT (U) Key

This key selects the engineering unit of measure desired when the PC is in NORMAL and HOLD modes. The UNIT key selects MIN or MAX in MIN/MAX mode, resets/restarts in AVE mode, and selects °C or °F in TEMP mode.

Zeroing the PC

To Zero the PC, first turn off pressure sources and vent pressure ports to atmosphere. Then simultaneously press and hold the **F and U** keys until “F.CAL” is displayed. The process is complete when the display changes from “----” to a “zero” reading.

Note: The PC can only be zeroed if the applied pressure is within $\pm 1\%$ of the full scale range. Further details are provided under Field Recalibration.

Set Functional Mode

There are 5 possible modes: NORMAL, HOLD, MIN/MAX, AVE and TEMP ($^{\circ}\text{F}$ or $^{\circ}\text{C}$). NORMAL (pressure measure mode) is the default on power up, and is active when the latter four modes are not displayed on the LCD.

Functional Modes	
HOLD	Freezes the pressure measurement on the display, however, the bar graph is still active
MIN/MAX	Displays the MIN and MAX pressures
AVE	Displays a filtered average of the pressure measurements
TEMP	Displays the internal ambient temperature of the PC

The NORMAL mode has an additional sub mode referred to as “REC” or record mode, which is described later.

For pressure measurements:

- Selecting the HOLD mode (HOLD icon) will immediately freeze the displayed pressure measurement.
- Selecting the MIN/MAX mode (the MAX or MIN icon) will display the MAX and MIN pressures since power on or since the MAX and/or MIN value was Zeroed (see next).
 - the **UNIT** key will toggle between the MAX and MIN pressure measurement
 - the Zero function (**F and U**) will zero (or reset) the MAX and/or MIN values individually
- Selecting the AVE mode (AVE icon) will begin averaging the pressure measurements. While in this mode, the displayed pressure is the average of all the pressure measurements since entering AVE mode or since restarting AVE mode (see next). This mode can be used to display a stable pressure reading that may be fluctuating or noisy.
 - the **UNIT** key will restart (or reset) the averaging

The red backlight will illuminate when the PC is measuring pressure values outside its calibrated range. When the red backlight is on, the accuracy of these measurements is uncharacterized.

Beyond 110% of the calibrated range, “----” will be displayed. The red backlight will be illuminated in both cases.


The minimum and maximum pressure the PC has measured is permanently recorded for factory warranty issues.

For temperature measurements:

- Selecting the TEMP mode (the °F or °C icon) will display the internal ambient temperature of the PC.
 - the **UNIT** key will toggle between °F and °C

The minimum and maximum temperature the PC has measured is permanently recorded for factory warranty issues.

Liquid Crystal Display (LCD)

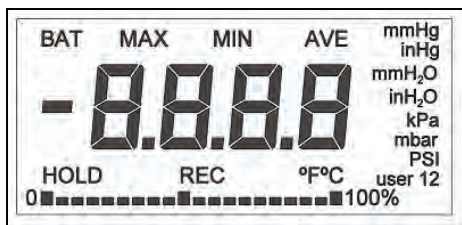

The LCD displays the:

- current Functional Mode via icons,
- Pressure or Temperature measurement via large digits,
- Pressure measurement via bar graph, and
- Pressure or Temperature engineering units via icons.

A low battery warning (the BAT icon) is displayed when the batteries require replacement. Approximately 2 hours of run time is available immediately following a low battery warning.

The bar graph at the bottom of the display always shows a reading of the currently applied pressure as a percent of the full scale of the PC.

The LCD incorporates two backlights:

- a green backlight which is user activated via the BACKLIGHT key, and
- **a red backlight which is automatically activated during an error/over-range condition**

During an error or over-range condition, the red backlight will “over-ride” the green backlight. However, once the error or over-range condition is corrected, the green backlight will be restored to its previous state (if the backlight auto-off timer did not expire).

The backlight should be turned off when not needed to conserve battery power. The backlight feature will be reduced when the PC is in low battery mode.

Engineering Units Select

For pressure measurements:

mmHg (@ 0°C)
inHg (@ 0°C)
inH2O (@20°C)
mmH2O (@20°C)
kPa
mbar
bar
PSI
user 1 (optional)
user 2 (optional)

To change the pressure units, press the **UNIT** key while in **NORMAL** or **HOLD** modes.

“user 1” and “user 2” are reserved for custom user defined units of measure. Contact your supplier if this support is required.

Note: Depending upon the pressure range of the PC, some engineering units may not be available (i.e. they will be skipped).

When the PC is turned on, it will default to the last selected pressure engineering units.

For temperature measurements:

°F
°C

To change the temperature units, press the **UNIT** key while in **TEMP** mode.

Notes: When the **TEMP** mode is selected, the PC will default to the last selected temperature engineering units.

Record Mode

The PC can store up to 240 pressure measurements (also called values or points) in a single record (REC) session. For maximum flexibility, a REC session can be:

- Automatic - the current value is automatically stored every 5 seconds, for up to 20 minutes
- Manual - the current value is stored every time the **U** key is pressed, up to 240 times

Both types of REC sessions can store between 1 and 240 measurements. The measurement data is preserved in non-volatile memory until another REC session is started.

REC Data:

First, set the PC to NORMAL mode (no functional mode icons displayed). Then enter **REC Data mode** by pressing both the **B and F** keys until the **REC** icon begins flashing.

Second, choose the type of REC session.

To start an **automatic** REC session, press the **F** key. This will delete the previously stored pressure measurement and store the current pressure measurement. Then, every 5 seconds, the current pressure value will be stored.

To start a **manual** REC session, press the **U** key. This will delete the previously stored session and store the current pressure measurement. Then, every time the **U** key is pressed, the current pressure value will be stored.

For both types of REC session, the pressure value on the LCD will blank briefly every time a sample is stored, and after 240 measurements have been recorded, the following step (stop and exit REC Data mode) will happen automatically.

Third, to stop and **exit REC Data mode**, press both the **B and F** keys. All previously stored REC session data will be saved and the PC will return to NORMAL mode (the REC icon will go off). This step can be done anytime the REC icon is flashing.

REC View:

First, set the PC to NORMAL mode (no functional mode icons on). Then **enter REC View mode** by pressing both the **B and U** keys until the **REC** icon illuminates.

Second, press the **U** key to cycle through the stored values. The pressure value on the LCD will blank briefly every time a sample is displayed, and after all the recorded samples have been viewed, “----” will be displayed and the following step (stop and exit REC View mode) will happen automatically.

Third, to stop and **exit REC View mode**, press both the **B and U** keys. The PC will return to NORMAL mode (the REC icon will go off). This step can be done anytime the REC icon is on.

Auto Shut-Off

To conserve battery life, the PC will automatically power off after 30 minutes of keypad inactivity.

Field Recalibration

The PC can be recalibrated in the field for zero and span. The proper primary standards must be available prior to calibrating the unit. These standards should meet the accuracy requirements for your company or industry. The factory follows the guidelines established by ANSI / NCSL Z540-1-1994 which requires that the primary standard be 4 times more accurate than the unit under test.

The field recalibration is not intended to replace the original factory calibration. It is intended to trim the factory calibration curve fit to accommodate slight changes in sensor characteristics over time.

ZERO

To Zero the PC, first turn off pressure sources and vent pressure ports to atmosphere. Then simultaneously press and hold the **F and U** keys until “F.CAL” is displayed. The process is complete when the display changes from “----” to a “zero” reading.

Note: The PC can only be zeroed if the applied pressure is within 1% of the full scale range.

The above process applies only to gauge and differential pressure instruments. To recalibrate the zero on an absolute pressure instrument, the applied pressure must be within 10 times the full scale accuracy term of the original factory calibrated zero. 200 microns is the standard vacuum reference for all absolute pressure sensors available in for the PC.

Note: It should be noted that if the zero reference source used to recalibrate any pressure instrument is not accurate, the PC zero can be recalibrated to a maximum discrepancy of 1.0% of the original factory zero. This can create a 1.0% offset in all pressure measurements after the recalibration of zero.

If this procedure generates a new value outside this limit, the red backlight will flash to indicate the procedure failed and the previous value was retained.

SPAN

First, before the PC can be spanned, it must first be zeroed.

Second, to Span the PC, a calibration specific pressure must be applied. If this Span pressure is known (because the unit has been spanned previously), skip the next step.

To **determine the Span pressure**, make sure the pressure sources are still vented (i.e. still at zero), then press and hold the **O and B** keys until “F.CAL” is displayed. Immediately following “F.CAL” is the value of the pressure that should be applied. The red backlight will flash to indicate the PC was not spanned (since there was no pressure applied).

Third, apply the Span pressure to the PC and let the pressure stabilize. Then press and hold the **O and B** keys until “F.CAL” is displayed. Immediately following “F.CAL” is the value of the pressure that should be applied. The display will read “----” during the spanning process. The process is complete when the display changes from “----” to the Span pressure reading.

Note: The PC can only be spanned if the calculated measured span is within 5 times full scale accuracy term of the original factory calibrated span pressure

For example, given:

Accuracy = 0.1% FS, FS = 100 PSI, and Span = 70 PSI the Measured Span must be within ± 0.5 PSI of 70 PSI

Note: It should be noted that if the span pressure source used to recalibrate any pressure instrument is not accurate, the PC span can be recalibrated to a maximum discrepancy of 0.5% of the original factory span calibration pressure. This can create a 0.5% gain error in all pressure measurements after the recalibration of span.

If this procedure generates a new value outside this limit, the red backlight will flash to indicate the procedure failed and the previous value was retained.

Restore Factory Defaults

The factory calibration defaults can be restored in the PC by simultaneously pressing the **O and F and U** keys until the display shows “----”. The process is complete when the display changes from “----” to the current pressure reading.

Specifications

<p>Type and Range:</p> <p>All sensors are non-isolated</p> <p>D – 28 inH₂O (1 psi)</p> <p>D – 138 inH₂O (5 psi)</p> <p>D – 416 inH₂O (15 psi)</p> <p>D – 832 inH₂O (30 psi)</p> <p>D – 2000 inH₂O (72.3 psi)</p> <p>A – 775 mmHg (15 psia)</p> <p>A – 1551 mmHg (30 psia)</p> <p>A – 2585 mmHg (50 psia)</p> <p>G – 5 psi</p> <p>G – 15 psi</p> <p>G – 30 psi</p> <p>G – 50 psi</p> <p>G – 100 psi</p>
<p>Accuracy:</p> <p>±0.10% of FS</p> <p>Includes the combined effects of temperature, linearity, repeatability, hysteresis and resolution.</p>
<p>Temperature:</p> <p>Storage = -40°C to +60°C (-40°F to +140°F)</p> <p>Operating = -10°C to +50°C (14°F to +122°F)</p> <p>Reading = Inside product @ ±1°C</p>
<p>Media Compatibility:</p> <p>Clean, dry, non-corrosive gases only.</p>
<p>Pressure Limits:</p> <p>D – 3 □FS range on high side only or 200 PSI, whichever is less</p> <p>G or A – 3 □FS range or 200 PSI, whichever is less</p>
<p>Connection:</p> <p>D – 1/8" female NPT, 316SS. P1 = high side, P2 = low side</p> <p>G – 1/8" female NPT, P1 port only, P2 vent</p> <p>A – 1/8" female NPT, P1 port only, P2 vent</p> <p>See User Connection Section of this Manual</p>
<p>Battery Type:</p> <p>3 x AA battery, field replaceable.</p> <p>Alkaline (A900614-00011):</p> <p>Duracell, PC1500, 1.5V, 2000mAh</p> <p>Duracell, MN1500, 1.5V, 2000mAh</p> <p>Varta, 4906, 1.5V, 2600mAh</p>

<p>Battery Operation: >300 hours continuous use without the backlight, 1 year shelf life, auto power off set at 30 minutes, low battery warning giving approximately 2 hours of run time.</p>
<p>Enclosure: (6.5" □3.2" □1.1") Polycarbonate, Permanently Static Dissipative, ESD Protection</p> <p>Enclosure with Boot: (6.8" □3.5" □1.3")</p>
<p>Display Resolution: Range 0-9 0-99 0-999 0-9999 Display x.yyy xx.yy xxx.y xxxx</p> <p>Some pressure units may display differently depending upon full scale range and accuracy</p>
<p>Display Warnings</p> <ul style="list-style-type: none"> ° HI = The temperature of PC above valid calibration range/field recalibration value. ° LO = The temperature of PC below valid calibration range/field recalibration value. P HI = Pressure applied to PC above valid calibration range/field recalibration value. P LO = Pressure applied to PC below valid calibration range/field recalibration value.

Certification/Safety/Warnings

The Pressure Calibrator is for general purpose use only.

Note the following **WARNINGS and requirements**:

- User must use bulkhead fitting hex surface when attaching user's 1/8" NPT fitting. When making mechanical connections, **DO NOT** apply torque to bulkhead fitting that causes the fitting to turn or twist with respect to plastic enclosure. To do so, will damage the product and void the warranty.

Changing the Batteries

The PC is powered by three, 1.5 volt AA size batteries. When the output of the batteries drop below a normal level, the display will activate the "BAT" icon, indicating a low battery condition. A low battery condition may affect performance, and therefore, the unit should not be used to measure pressure. All three batteries should be replaced.

To replace the battery locate the battery compartment in the bottom rear of the PC. Remove the two screws located at the top center and bottom center of the battery cover by turning them counterclockwise until they are fully disengaged from the PC base. Lift the cover from the back of the unit. **Do not remove the pink antistatic foam that is attached to the inside of the battery cover. This foam is necessary to properly secure the batteries under specified shock and vibration conditions!**

Remove the batteries by pulling the positive side first straight out of the battery compartment. Note the positive (+) and negative (-) battery polarity markings at the bottom of the compartment, as shown below.




Install the three batteries by sliding them into the bottom of the battery slots, making sure the polarity markings on the batteries align with the markings shown in the battery compartment. The battery compartment has stand-offs molded into the side of the compartment. When a battery is installed with the polarity reversed, the stand-offs prevent the negative battery terminal from contacting the positive terminal in the battery compartment. The unit will not power up when a battery is installed this way. Should this happen, simply reverse the battery to correct the polarity.

With the batteries secured in the battery compartment, replace the compartment cover. The cover has only one orientation for correct alignment. The “WARNING DO NOT OPEN IN EXPLOSIVE ATMOSPHERE” statement on the battery cover must be visible and aligned in the approximate middle of the PC case. To secure the cover, torque the screws clockwise to 1.6 in-lbs. Do not over tighten.


User Connections

Connection: 1/8" female NPT, 316SS. The pressure connections (P1 and P2) are marked on top of the keypad as shown on page 1.

“D” or Differential models have 2 used pressure ports. P1 is the high pressure connection and P2 is the low pressure connection (as shown below).

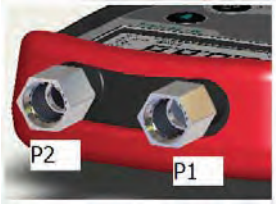

“G” Gauge and “A” Absolute models have one used pressure port, P1. P2 is used to vent enclosure/sensor to atmosphere (as shown above).

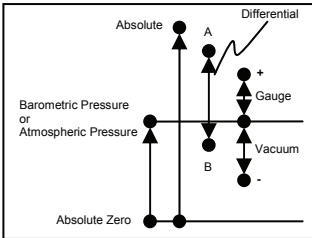

WARNING → Connection to the incorrect pressure port may cause damage to the pressure sensor. Once this sort of damage occurs, the unit must be returned to the factory for sensor replacement.

WARNING → User must use bulkhead fitting hex surface when attaching user's 1/8" NPT fitting. No torque can be applied to bulkhead fitting with respect to plastic enclosure.

Contact Information

If the PC cannot be zeroed, spanned, or is damaged, it must be returned to the factory for servicing. In this case, contact your supplier for a return number.



WARRANTY/DISCLAIMER

OMEGA ENGINEERING, INC. warrants this unit to be free of defects in materials and workmanship for a period of **13 months** from date of purchase. OMEGA's WARRANTY adds an additional one (1) month grace period to the normal **one (1) year product warranty** to cover handling and shipping time. This ensures that OMEGA's customers receive maximum coverage on each product.

If the unit malfunctions, it must be returned to the factory for evaluation. OMEGA's Customer Service Department will issue an Authorized Return (AR) number immediately upon phone or written request. Upon examination by OMEGA, if the unit is found to be defective, it will be repaired or replaced at no charge. OMEGA's WARRANTY does not apply to defects resulting from any action of the purchaser, including but not limited to mishandling, improper interfacing, operation outside of design limits, improper repair, or unauthorized modification. This WARRANTY is VOID if the unit shows evidence of having been tampered with or shows evidence of having been damaged as a result of excessive corrosion; or current, heat, moisture or vibration; improper specification; misapplication; misuse or other operating conditions outside of OMEGA's control. Components in which wear is not warranted, include but are not limited to contact points, fuses, and triacs.

OMEGA is pleased to offer suggestions on the use of its various products. However, OMEGA neither assumes responsibility for any omissions or errors nor assumes liability for any damages that result from the use of its products in accordance with information provided by OMEGA, either verbal or written. OMEGA warrants only that the parts manufactured by the company will be as specified and free of defects. OMEGA MAKES NO OTHER WARRANTIES OR REPRESENTATIONS OF ANY KIND WHATSOEVER, EXPRESSED OR IMPLIED, EXCEPT THAT OF TITLE, AND ALL IMPLIED WARRANTIES INCLUDING ANY WARRANTY OF MERCHANTABILITY AND FITNESS FOR A PARTICULAR PURPOSE ARE HEREBY DISCLAIMED. LIMITATION OF LIABILITY: The remedies of purchaser set forth herein are exclusive, and the total liability of OMEGA with respect to this order, whether based on contract, warranty, negligence, indemnification, strict liability or otherwise, shall not exceed the purchase price of the component upon which liability is based. In no event shall OMEGA be liable for consequential, incidental or special damages.

CONDITIONS: Equipment sold by OMEGA is not intended to be used, nor shall it be used: (1) as a "Basic Component" under 10 CFR 21 (NRC), used in or with any nuclear installation or activity; or (2) in medical applications or used on humans. Should any Product(s) be used in or with any nuclear installation or activity, medical application, used on humans, or misused in any way, OMEGA assumes no responsibility as set forth in our basic WARRANTY/DISCLAIMER language, and, additionally, purchaser will indemnify OMEGA and hold OMEGA harmless from any liability or damage whatsoever arising out of the use of the Product(s) in such a manner.

RETURN REQUESTS / INQUIRIES

Direct all warranty and repair requests/inquiries to the OMEGA Customer Service Department. BEFORE RETURNING ANY PRODUCT(S) TO OMEGA, PURCHASER MUST OBTAIN AN AUTHORIZED RETURN (AR) NUMBER FROM OMEGA'S CUSTOMER SERVICE DEPARTMENT (IN ORDER TO AVOID PROCESSING DELAYS). The assigned AR number should then be marked on the outside of the return package and on any correspondence.

The purchaser is responsible for shipping charges, freight, insurance and proper packaging to prevent breakage in transit.

FOR **WARRANTY** RETURNS, please have the following information available BEFORE contacting OMEGA:

1. Purchase Order number under which the product was PURCHASED,
2. Model and serial number of the product under warranty, and
3. Repair instructions and/or specific problems relative to the product.

FOR **NON-WARRANTY** REPAIRS, consult OMEGA for current repair charges. Have the following information available BEFORE contacting OMEGA:

1. Purchase Order number to cover the COST of the repair,
2. Model and serial number of the product, and
3. Repair instructions and/or specific problems relative to the product.

OMEGA's policy is to make running changes, not model changes, whenever an improvement is possible. This affords our customers the latest in technology and engineering.

OMEGA is a registered trademark of OMEGA ENGINEERING, INC.

© Copyright 2009 OMEGA ENGINEERING, INC. All rights reserved. This document may not be copied, photocopied, reproduced, translated, or reduced to any electronic medium or machine-readable form, in whole or in part, without the prior written consent of OMEGA ENGINEERING, INC.

Where Do I Find Everything I Need for Process Measurement and Control? **OMEGA...Of Course!** *Shop online at omega.comsm*

TEMPERATURE

- Thermocouple, RTD & Thermistor Probes, Connectors, Panels & Assemblies
- Wire: Thermocouple, RTD & Thermistor
- Calibrators & Ice Point References
- Recorders, Controllers & Process Monitors
- Infrared Pyrometers

PRESSURE, STRAIN AND FORCE

- Transducers & Strain Gages
- Load Cells & Pressure Gages
- Displacement Transducers
- Instrumentation & Accessories

FLOW/LEVEL

- Rotameters, Gas Mass Flowmeters & Flow Computers
- Air Velocity Indicators
- Turbine/Paddlewheel Systems
- Totalizers & Batch Controllers

pH/CONDUCTIVITY

- pH Electrodes, Testers & Accessories
- Benchtop/Laboratory Meters
- Controllers, Calibrators, Simulators & Pumps
- Industrial pH & Conductivity Equipment

DATA ACQUISITION

- Data Acquisition & Engineering Software
- Communications-Based Acquisition Systems
- Plug-in Cards for Apple, IBM & Compatibles
- Data Logging Systems
- Recorders, Printers & Plotters

HEATERS

- Heating Cable
- Cartridge & Strip Heaters
- Immersion & Band Heaters
- Flexible Heaters
- Laboratory Heaters

ENVIRONMENTAL MONITORING AND CONTROL

- Metering & Control Instrumentation
- Refractometers
- Pumps & Tubing
- Air, Soil & Water Monitors
- Industrial Water & Wastewater Treatment
- pH, Conductivity & Dissolved Oxygen Instruments