

User's Guide



Shop online at

omega.com[®]

Ω OMEGA[®]

omega.com

e-mail: info@omega.com

For latest product manuals:

omegamanual.info

ISO 9001
CERTIFIED
CORPORATE QUALITY

STAMFORD, CT

ISO 9002
CERTIFIED
CORPORATE QUALITY

MANCHESTER, UK

DP63300-TC Digital Panel Thermocouple Meter



| | |
|---|---|
| OMEGAnet® Online Service omega.com | Internet e-mail info@omega.com |
|---|---|

Servicing North America:

U.S.A.: One Omega Drive, P.O. Box 4047
ISO 9001 Certified Stamford, CT 06907-0047
TEL: (203) 359-1660 FAX: (203) 359-7700
e-mail: info@omega.com

Canada: 976 Bergar
Laval (Quebec) H7L 5A1, Canada
TEL: (514) 856-6928 FAX: (514) 856-6886
e-mail: info@omega.ca

For immediate technical or application assistance:

U.S.A. and Canada: Sales Service: 1-800-826-6342/1-800-TC-OMEGA®
Customer Service: 1-800-622-2378/1-800-622-BEST®
Engineering Service: 1-800-872-9436/1-800-USA-WHEN®

Mexico: En Español: (001) 203-359-7803 e-mail: espanol@omega.com
FAX: (001) 203-359-7807 info@omega.com.mx

Servicing Europe:

Czech Republic: Frystatska 184, 733 01 Karviná, Czech Republic
TEL: +420 (0)59 6311899 FAX: +420 (0)59 6311114
Toll Free: 0800-1-66342
e-mail: info@omegashop.cz

Germany/Austria: Daimlerstrasse 26, D-75392 Deckenpfronn, Germany
TEL: +49 (0)7056 9398-0 FAX: +49 (0)7056 9398-29
Toll Free in Germany: 0800 639 7678
e-mail: info@omega.de

United Kingdom: One Omega Drive, River Bend Technology Centre
ISO 9002 Certified Northbank, Irlam, Manchester
M44 5BD United Kingdom
TEL: +44 (0)161 777 6611 FAX: +44 (0)161 777 6622
Toll Free in United Kingdom: 0800-488-488
e-mail: sales@omega.co.uk

It is the policy of OMEGA Engineering, Inc. to comply with all worldwide safety and EMC/EMI regulations that apply. OMEGA is constantly pursuing certification of its products to the European New Approach Directives. OMEGA will add the CE mark to every appropriate device upon certification.

The information contained in this document is believed to be correct, but OMEGA accepts no liability for any errors it contains, and reserves the right to alter specifications without notice.

WARNING : These products are not designed for use in, and should not be used for, human applications.



- PROGRAMMABLE TC TYPE (T, E, J, K, R, S, B, N or mV SCALE)
- CONFORMS TO ITS-90 STANDARDS
- SELECTABLE °F OR °C WITH 0.1 OR 1 DEGREE DISPLAY RESOLUTION
- STATE-OF-THE-ART DIGITAL ELECTRONICS FOR GREATER ACCURACY AND RELIABILITY
- FULL 4-DIGIT, HIGH VISIBILITY, 0.56" (14.2 mm) HIGH RED LED DISPLAY
- PROGRAMMABLE TEMPERATURE OFFSET
- PROGRAMMABLE DIGITAL FILTERING ENHANCES STABILITY
- PEAK/VALLEY (HI/LO READING) MEMORY
- NEMA 4X/IP65 SEALED FRONT BEZEL
- CUSTOM UNITS OVERLAY WITH BACKLIGHT

GENERAL DESCRIPTION

The DP63300-TC Thermocouple Meter accepts inputs from standard thermocouples and precisely linearizes them. A full 4-digit display accommodates a wide range of temperature inputs. The unit automatically compensates for cold junction, NBS linearity and the meter's zero and span.

The meter features a readout choice of either Fahrenheit or Celsius with 0.1 or 1 degree resolution. English Style display prompts and front panel buttons aid the operator through set-up and operation. With a few simple steps the unit can be used as a millivolt meter by selecting "mVt" for thermocouple type. This mode is useful in monitoring and displaying the actual voltage produced at the thermocouple probe junction and as an aid in troubleshooting for a faulty thermocouple probe.


The meter provides a Peak (HI) and Valley (LO) reading memory with selectable capture delay time. The capture delay is used to prevent detection of false Peak or Valley readings that may occur during start-up or unusual process events. The Peak and Valley readings are stored at power-down to allow monitoring the process limits over any length of time (shifts, days, etc.).

Programmable digital filtering enhances the stability of the reading. All set-up data is stored in E²PROM, which will hold data for a minimum of 10 years without power. The meter has several built-in diagnostic functions to alert operators of any malfunction.

Extensive testing of noise interference mechanisms and full burn-in makes the indicator extremely reliable in industrial environments. The front bezel meets NEMA 4X/IP65 requirements for wash down applications.

SAFETY SUMMARY

All safety related regulations, local codes and instructions that appear in the literature or on equipment must be observed to ensure personal safety and to prevent damage to either the instrument or equipment connected to it. If equipment is used in a manner not specified by the manufacturer, the protection provided by the equipment may be impaired. Do not use this unit to directly command motors, valves, or other actuators not equipped with safeguards. To do so, can be potentially harmful to persons or equipment in the event of a fault to the unit.

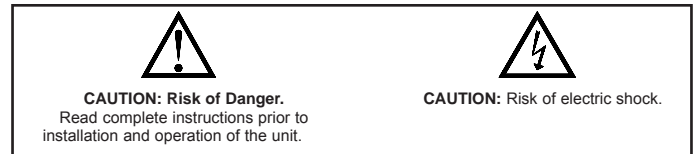

DEFINITION OF TERMS

INSTALLATION CATEGORY (overvoltage category) I:

Signal level, special equipment or parts of equipment, telecommunication, electronic, etc. with smaller transient overvoltages than Installation Category (overvoltage category) II.

INSTALLATION CATEGORY (overvoltage category) II:

Local level, appliances, portable equipment, etc. with smaller transient overvoltages than Installation Category (overvoltage category) III.

DIMENSIONS In inches (mm)

Note: Recommended minimum clearance (behind the panel) for mounting clip installation is 2.1" (53.4) H x 5" (127) W.

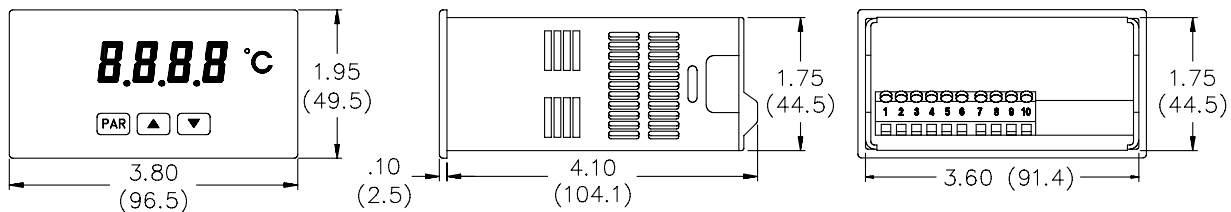


TABLE OF CONTENTS

| | | | |
|--|---|---|---|
| General Meter Specifications | 4 | Reviewing the Front Buttons and Display . . . | 6 |
| Accessories | 4 | Programming the Meter | 7 |
| Installing the Meter | 5 | Calibrating the Meter | 8 |
| Wiring the Meter | 5 | Troubleshooting | 9 |

GENERAL METER SPECIFICATIONS

- DISPLAY:** 4-digit, 0.56" (14.2 mm) high LED, minus sign displayed for negative temperatures.
Overrange/Underrange Input: Flashing "OL OL" or "UL UL"
Overrange/Underrange Display: "... " or "-. . . ."
- POWER:** 85 to 250 VAC, 50/60 Hz, 6 VA
Isolation: 2300 Vrms for 1 min. between input and supply (300 V working voltage)
- CONTROLS:** Three front panel push buttons for meter set-up. Rear terminal input for disabling the front panel.
- THERMOCOUPLE TYPES:** T, E, J, K, R, S, B, N or mV scale
- RESOLUTION:** 1 degree for all types, or 0.1 degree for T, E, J, K and N only
- THERMOCOUPLE RANGE AND ACCURACY:** All errors include NBS conformity, cold junction effect and A/D conversion errors at 23°C after 60 minutes warm-up. Relative Humidity less than 85%.

| TC TYPE | RANGE | ACCURACY | WIRE COLOR |
|---------|------------------------------------|----------------|------------|
| T | -200 to +400°C -328 to +752°F | 0.8°C 1.4°F | blue |
| E | -200 to +1000°C -328 to +1832°F | 0.8°C 1.4°F | purple |
| J | -200 to +760°C -328 to +1400°F | 0.8°C 1.4°F | white |
| K | -200 to +1250°C -328 to +2282°F | 0.8°C 1.4°F | yellow |
| R | 0 to +1768°C +32 to +3214°F | 2.1°C 3.8°F | black |
| S | 0 to +1768°C +32 to +3214°F | 2.1°C 3.8°F | black |
| B | +150 to +1820°C +302 to +3308°F | 2.3°C 4.1°F | grey |
| N | -200 to +1300°C -328 to +2372°F | 0.8°C 1.4°F | orange |
| mV | -10.00 to +80.00 mV | 0.01% | |

- INPUT IMPEDANCE:** 20 MΩ, all types
- LEAD RESISTANCE EFFECT:** 20 μV/350 Ω
Max Input Voltage Protection: 70 VDC continuous
- OPEN THERMOCOUPLE DETECTION:** Display Flashes: "OPEN"
- COLD JUNCTION COMPENSATION:** Automatic, 0.02 degree/degree. Disabled for linear mV scale.
- READING RATE:** 2.5 readings/second
- RESPONSE TIME:** 2 seconds to settle for step input (increases with programmable digital filtering)
- LOW FREQUENCY NOISE REJECTION:**
Normal Mode Rejection: 45 dB @ 50/60 Hz (may be improved by programmable digital filtering)
Common Mode Rejection: 120 dB, DC to 50/60 Hz
- ENVIRONMENTAL CONDITIONS:**
Operating Temperature Range: 0 to 50 °C
Storage Temperature Range: -40 to 80 °C

- Operating and Storage Humidity:** 85% max (non-condensing) from 0 to 50 °C
Span Drift: 40 ppm/°C
Zero Drift: 1 μV/°C
Altitude: Up to 2000 meters.

15. CERTIFICATIONS AND COMPLIANCES:

SAFETY

UL Recognized Component, File # E313607, UL6101A-1, CSA C22.2 No. 1010-1 Recognized to U.S. and Canadian requirements under the Component Recognition Program of Underwriters Laboratories, Inc.
 UL Listed, File # E313547, UL508, CSA C22.2 No. 14-M95 LISTED by Und. Lab. Inc. to U.S. and Canadian safety standards
 Type 4X Enclosure rating (Face only), UL50
 IEC 61010-1, EN 61010-1: Safety requirements for electrical equipment for measurement, control, and laboratory use, Part 1.
 IP65 Enclosure rating (Face only), IEC 529

ELECTROMAGNETIC COMPATIBILITY

Emissions and Immunity to EN 61326: Electrical Equipment for Measurement, Control and Laboratory use.

Immunity:

| | | |
|---------------------------|---------------|---|
| Electrostatic discharge | EN 61000-4-2 | Criterion A 4 kV contact discharge 8 kV air discharge |
| Electromagnetic RF fields | EN 61000-4-3 | Criterion A 10 V/m |
| Fast transients (burst) | EN 61000-4-4 | Criterion A 2 kV power 2 kV signal |
| Surge | EN 61000-4-5 | Criterion A 1 kV L-L, 2 kV L&N-E power 1 kV signal |
| RF conducted interference | EN 61000-4-6 | Criterion A 3 V/rms |
| Voltage dip/interruptions | EN 61000-4-11 | Criterion A 0.5 cycle |

Emissions:

| | | |
|-----------|----------|---------|
| Emissions | EN 55011 | Class B |
|-----------|----------|---------|

Note:

- Criterion A: Normal operation within specified limits.**
- CONSTRUCTION:** This unit is rated for NEMA 4X/IP65 indoor use. One piece bezel/case. Flame resistant. Panel gasket and mounting clip included.
- CONNECTIONS:** High compression cage-clamp terminal block
 Wire Strip Length: 0.3" (7.5 mm)
 Wire Gauge: 30-14 AWG copper wire
 Torque: 4.5 inch-lbs (0.51 N-m) max.
- WEIGHT:** 0.65 lbs. (0.24 Kg)

ACCESSORIES

UNITS LABEL KIT


Each meter has a units indicator with backlighting that can be customized using the Units Label Kit. The backlight is controlled in the programming.

Each meter is shipped with °F and °C overlay labels which can be installed into the meter's bezel display assembly.

1.0 INSTALLING THE METER

Installation

The DP63300 meets NEMA 4X/IP65 requirements when properly installed. The unit is intended to be mounted into an enclosed panel. Prepare the panel cutout to the dimensions shown. Remove the panel latch from the unit. Slide the panel gasket over the rear of the unit to the back of the bezel. The unit should be installed fully assembled. Insert the unit into the panel cutout.

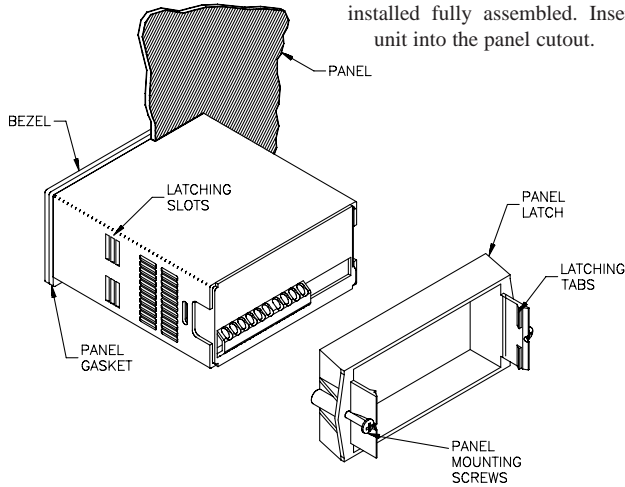

While holding the unit in place, push the panel latch over the rear of the unit so that the tabs of the panel latch engage in the slots on the case. The panel latch should be engaged in the farthest forward slot possible. To achieve a proper seal, tighten the latch screws evenly until the unit is snug in the panel (Torque to approximately 7 in-lbs [79N-cm]). Do not over-tighten the screws.


Installation Environment

The unit should be installed in a location that does not exceed the maximum operating temperature and provides good air circulation. Placing the unit near devices that generate excessive heat should be avoided.

The bezel should be cleaned only with a soft cloth and neutral soap product. Do NOT use solvents. Continuous exposure to direct sunlight may accelerate the aging process of the bezel.

Do not use tools of any kind (screwdrivers, pens, pencils, etc.) to operate the keypad of the unit.

PANEL CUT-OUT

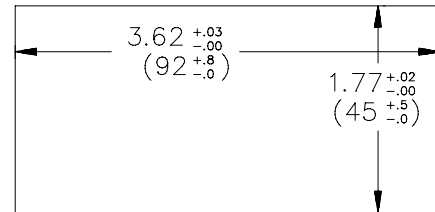


2.0 WIRING THE METER

POWER WIRING

Primary AC power is connected to Terminals 1 and 2. To reduce the chance of noise spikes entering the AC line and affecting the indicator, the AC power should be relatively “clean” and within the specified limits. Drawing power from heavily loaded circuits or circuits which also power loads that cycle on and off, (contactors, relays, motors, machinery, etc.) should be avoided.

AC Power

 Terminal 1: VAC
Terminal 2: VAC



PROGRAM DISABLE INPUT WIRING

 
PGM.DIS. (Terminal 3) is a digital input that is active when connected to Comm (Terminal 4). Any form of mechanical switch or current sinking logic with less than 0.7 V saturation may be used. The use of shielded cable is recommended. Follow the EMC Installation Guidelines for shield connection.



SIGNAL WIRING (TC SENSOR)

Remove power and connect the negative thermocouple lead (always red) to TC- (Terminal 6) and the positive lead to TC+ (Terminal 5). Be certain that connections are clean and tight. If the thermocouple probe is to be mounted away from the meter, thermocouple extension grade wire must be used (copper wire will not work). Use the correct type and observe the correct polarity. Always refer to the sensor manufacturer's instructions for probe wiring connections, if available. For multi-probe temperature averaging applications, two or more thermocouple probes may be connected at the meter. (Always use the same type.) In order to minimize the chances of coupling noise into the wires and subsequently causing bouncy and erroneous readings, proper guidelines for thermocouple wire routing must be followed.

Thermocouple



WIRING OVERVIEW

Electrical connections are made via screw-clamp terminals located on the back of the meter. All conductors should conform to the meter's voltage and current ratings. All cabling should conform to appropriate standards of good installation, local codes and regulations. It is recommended that the power supplied to the meter be protected by a fuse or circuit breaker.

When wiring the meter, compare the numbers embossed on the back of the meter case against those shown in wiring drawings for proper wire position. Strip the wire, leaving approximately 0.3" (7.5 mm) bare lead exposed (stranded wires should be tinned with solder). Insert the lead under the correct screw-clamp terminal and tighten until the wire is secure. (Pull wire to verify tightness.)

EMC INSTALLATION GUIDELINES

Although this meter is designed with a high degree of immunity to Electro-Magnetic Interference (EMI), proper installation and wiring methods must be followed to ensure compatibility in each application. The type of the electrical noise, source or coupling method into the meter may be different for various installations. The meter becomes more immune to EMI with fewer I/O connections. Cable length, routing, and shield termination are very important and can mean the difference between a successful or troublesome installation. Listed below are some EMC guidelines for successful installation in an industrial environment.

1. The meter should be mounted in a metal enclosure, which is properly connected to protective earth.
2. Use shielded (screened) cables for all Signal and Control inputs. The shield (screen) pigtail connection should be made as short as possible. The connection point for the shield depends somewhat upon the application. Listed below are the recommended methods of connecting the shield, in order of their effectiveness.
 - a. Connect the shield only at the panel where the unit is mounted to earth ground (protective earth).
 - b. Connect the shield to earth ground at both ends of the cable, usually when the noise source frequency is above 1 MHz.
 - c. Connect the shield to common of the meter and leave the other end of the shield unconnected and insulated from earth ground.
3. Never run Signal or Control cables in the same conduit or raceway with AC power lines, conductors feeding motors, solenoids, SCR controls, and heaters, etc. The cables should be run in metal conduit that is properly

grounded. This is especially useful in applications where cable runs are long and portable two-way radios are used in close proximity or if the installation is near a commercial radio transmitter.

4. Signal or Control cables within an enclosure should be routed as far as possible from contactors, control relays, transformers, and other noisy components.
5. In extremely high EMI environments, the use of external EMI suppression devices, such as ferrite suppression cores, is effective. Install them on Signal and Control cables as close to the unit as possible. Loop the cable through the core several times or use multiple cores on each cable for additional protection. Install line filters on the power input cable to the unit to suppress power line interference. Install them near the power entry point of the enclosure. The following EMI suppression devices (or equivalent) are recommended:
 - Ferrite Suppression Cores for signal and control cables:
 - Fair-Rite # 0443167251
 - TDK # ZCAT3035-1330A
 - Steward # 28B2029-0A0
 - Line Filters for input power cables:
 - Schaffner # FN610-1/07
 - Schaffner # FN670-1.8/07
 - Corcom # 1 VR3

Note: Reference manufacturer's instructions when installing a line filter.
6. Long cable runs are more susceptible to EMI pickup than short cable runs. Therefore, keep cable runs as short as possible.

3.0 REVIEWING THE FRONT BUTTONS AND DISPLAY



| KEY | DISPLAY MODE OPERATION |
|-----|--|
| PAR | Access Programming Mode or Display Input Reading |
| ▲ | Display Peak (HI) Reading |
| ▼ | Display Valley (LO) Reading |

| PROGRAMMING MODE OPERATION |
|--|
| Store selected parameter and index to next parameter |
| Increment value or change selection |
| Decrement value or change selection |

PEAK/VALLEY DETECTION

The meter will automatically record the highest input reading (peak) and the lowest input reading (valley) for later recall. These values are stored at power-down to allow monitoring the process limits over any length of time (shifts, days, etc.). A selectable capture delay time is used to prevent detection of false peak or valley readings caused by sudden short spikes or unusual process events.

The peak and valley readings can be viewed and reset using the front panel keys as described below.

View Peak, Valley and Input readings:

- To view Peak, press ▲. Meter displays **H I** followed by the Peak reading.
- To view Valley, press ▼. Meter displays **L V** followed by the Valley reading.
- To view Input, press **PAR**. Meter displays **I N P U T** followed by the current Input reading.

Note: The decimal point to the right of digit 1 flashes while the peak or valley reading is displayed.


Reset Peak and/or Valley to the current Input reading:

- To reset Peak and Valley, press ▲ and ▼ simultaneously.
- To reset Peak only, press and hold ▲ then press **PAR**.
- To reset Valley only, press and hold ▼ then press **PAR**.

In each case, the meter displays **r 5 E t** followed by the current Input reading.

4.0 PROGRAMMING THE METER

PROGRAMMING SEQUENCE

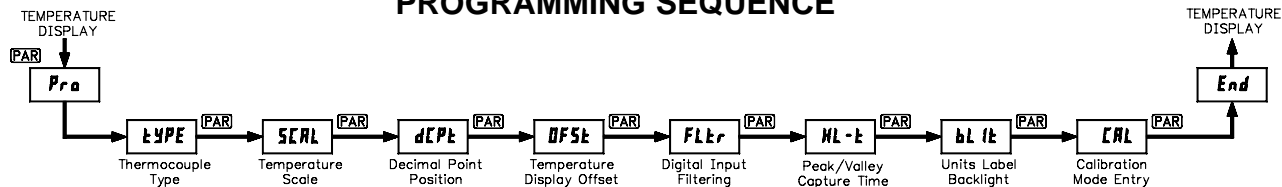

The Thermocouple Meter has up to seven programmable parameters that are entered in the sequence shown above, using the front panel push buttons. Depending on the thermocouple type selected, some parameters are not applicable and are bypassed in the sequence.

The last programming step offers the choice of entering calibration mode. From this mode, the user can restore the meter to factory default settings, or recalibrate the signal input and cold junction temperature if necessary. To prevent inadvertent entries, an access code must be keyed-in to perform any operations in calibration mode.

Note: Programming mode can be locked out using the Program Disable input terminal. With the PGM.DIS. terminal connected to COMM, the meter displays "LbE" when the PAR key is pressed, and will not enter programming mode.

PROGRAMMING MODE ENTRY

Press the **PAR** key to enter Programming Mode. The meter briefly displays **Pr a** followed by the first programming parameter described below.

 
PROGRAMMING MODE TIMEOUT

The Programming Mode has an automatic time out feature. If no keypad activity is detected for approximately 60 seconds, the meter automatically exits Programming Mode. The meter briefly displays **End** and returns to the normal display mode. When automatic timeout occurs, any changes that were made to the parameter currently being programmed will not be saved.

PROGRAMMING PARAMETERS

In Programming Mode, the display alternates between the parameter and the current selection or value for that parameter. The dual display with arrows is used below to illustrate the alternating display. The selection choices or value range for each parameter is shown to the right of the alternating display.

THERMOCOUPLE TYPE



| SELECTION | TC TYPE | SELECTION | TC TYPE |
|-----------|---------|-----------|--------------|
| t c - t | T | t c - S | S |
| t c - E | E | t c - b | B |
| t c - J | J | t c - n | N |
| t c - K | K | UOLt | mV indicator |
| t c - R | R | | |

Select the thermocouple type by pressing the arrow keys (▲ or ▼) to sequence through the selection list. When the desired selection is displayed, press the **PAR** key to save the selection and advance to the next parameter. Refer to the thermocouple range and accuracy specification for additional TC information.

TEMPERATURE SCALE



Select the desired temperature scale by pressing the up or down arrow keys. This setting does not change the Custom Units Overlay display (if installed). Press the **PAR** key to save the selection and advance to the next parameter.

DECIMAL POINT POSITION



Select the decimal point position by pressing the up or down arrow keys. This sets the display resolution to 1 or 0.1 degree. This parameter is not available for thermocouple types R, S and B, where the display resolution is always 1 degree. When mV indicator mode is selected for thermocouple type, the display resolution is fixed at 0.01 mV (10 μV).

Press the **PAR** key to save the selection and advance to the next parameter.

TEMPERATURE DISPLAY OFFSET



The temperature display can be corrected with an offset value. This can be used to compensate for probe errors or errors due to variances in probe placement, or to adjust the readout to a reference thermometer. Set the desired display offset value by pressing (and/or holding) the up or down arrow keys. When the desired offset value is displayed, press the **PAR** key to save the selection and advance to the next parameter. The display resolution for the offset value is the same as the decimal point position programmed above. The display offset is not available when mV indicator mode is selected for thermocouple type.

DIGITAL FILTERING



This parameter sets the amount of digital filtering applied to the input signal. If the temperature display is difficult to read due to small variations or noise, increased levels of filtering will help to stabilize the display. Although the digital filter features a "moving window" to help minimize response time, higher levels of filtering will result in slightly longer response times.

- 0 - no digital filtering
- 1 - normal filtering
- 2 - increased filtering
- 3 - maximum filtering

Set the desired level of input filtering by pressing the up or down arrow keys. Press the **PAR** key to save the selection and advance to the next parameter.

PEAK (HI)/ VALLEY (LO) CAPTURE DELAY TIME



When the Input display is above the present HI value or below the present LO value for the entered delay time, the meter will capture the Input display as the new HI or LO reading. A delay time helps to avoid false captures of sudden short spikes or Input display variations that may occur during start-up.

Set the desired capture delay time by pressing the up or down arrow keys. Press the **PAR** key to save the selection and advance to the next parameter.

UNITS LABEL BACKLIGHT



The Units Label Kit Accessory contains a sheet of custom unit overlays, which can be installed in the meter bezel display assembly. The unit of measure for the meter display is then visible when the label backlight is illuminated. The two most commonly used temperature unit labels (°F and °C) are supplied with the meter. Press the up or down arrow keys to select whether the units label backlight is illuminated. Press the **PAR** key to save the selection and advance to the next parameter.

PROGRAMMING MODE EXIT



Before exiting Programming Mode, the meter offers the choice of entering Calibration Mode. To exit Programming Mode without entering Calibration Mode, select **NO** and press the **PAR** key. The meter briefly displays **End** and returns to the normal display mode. All programmed selections are now transferred to non-volatile memory and are retained if power is removed from the meter.

(If power loss occurs during Programming Mode, verify parameter changes and reprogram, if necessary, when power is restored.)

5.0 CALIBRATING THE METER

CALIBRATION MODE



To enter Calibration Mode, select **CAL <> YES** at the end of Programming Mode, and press the **PAR** key. In Calibration Mode, the user can restore the meter to factory default settings or recalibrate the signal input if necessary.

To prevent inadvertent entries, an access code must be entered to perform any operation in Calibration Mode. Upon entering Calibration Mode, the meter initially displays Code 50. Press the up or down arrow keys to select the access code for the desired operation. If an access code other than those shown below is entered, the meter exits Calibration Mode and returns to normal display mode.

FACTORY SETTINGS



The factory settings for the programming parameters are shown in the previous section in the alternating display illustrations. All programming parameters can be restored to the factory default settings by entering the access Code 66 and pressing the **PAR** key. The meter briefly displays **r5E1** and then returns to Code 50. This procedure resets only parameters that are accessed through Programming Mode. The Calibration Mode settings (input calibration levels) are not affected.

METER INPUT CALIBRATION



The meter has been fully calibrated at the factory. If the meter appears to be indicating incorrectly or inaccurately, refer to the troubleshooting section before attempting this procedure. When re-calibration is required (*generally every 2 years*), the procedure should only be performed by qualified technicians using appropriate equipment. A precision thermometer (RTD, thermistor or similar type with an accuracy of ±0.3° C) and an accurate voltage source (0.01%) are required. The procedure consists of setting the cold junction temperature and applying accurate voltages to the meter input in a series of three steps. Allow a 60-minute warm-up before starting calibration.

COLD JUNCTION TEMPERATURE CALIBRATION

1. Connect a calibrated thermocouple (types T, E, J, K or N only) to the panel meter. Select the thermocouple type used in programming.
2. Connect the reference thermometer to the measuring end of the thermocouple. The two probes should be shielded from air movement and allowed sufficient time to equalize in temperature. (As an alternative, the DP63300-T thermocouple probe may be placed in a calibration bath of known temperature.)
3. From the normal indicator display mode, compare the display temperature to that of the reference thermometer. Allow 10 minutes for the temperature to equalize. The meter and the reference thermometer should agree to within 1° F (0.6° C).
4. If cold junction re-calibration is necessary (temperature out of tolerance), enter meter calibration mode and enter access Code 48. The meter display will alternate between **CJ1** and the old cold junction reading. At this point, key-in the new cold junction temperature according to the formula:

WHERE:

New Cold Junction Reading = Old Cold Junction Reading + Difference
(Difference = Reference Thermometer Temperature - Meter Display Temperature)

5. Press **PAR**. The meter briefly displays **----** to acknowledge the new cold junction value.

VOLTAGE CALIBRATION

Following cold junction calibration, the display **UCAL <> YES/NO** appears. Enter **YES** if input voltage calibration is desired. If **NO** is entered, the meter exits calibration and returns to normal display mode.

| DISPLAY | PARAMETERS | DESCRIPTION/COMMENT |
|---------|------------|--|
| 000u | 0.000 mV | Apply 0.000 mV, wait 20 seconds, press PAR . |
| 300u | 30.000 mV | Apply 30.000 mV, wait 20 seconds, press PAR . |
| 600u | 60.000 mV | Apply 60.000 mV, wait 20 seconds, press PAR . |

The meter briefly displays **End** and returns to the normal display mode. Calibration is now complete.

It is recommended to check calibration by selecting mV indication mode for thermocouple type (**TYPE <> UDL1**) and verifying unit accuracy at various points over the range of the meter (-10 to +80 mV).

TROUBLESHOOTING

The majority of all problems with the meter can be traced to improper connections or improper programming set-ups. Be sure all connections are clean and tight and check the programming set-ups for correct data.

For further technical assistance, contact technical support at the appropriate company numbers listed.

| PROBLEM | POSSIBLE CAUSE | REMEDIES |
|---------------------------------|---|---|
| NO DISPLAY | 1. Power off, improperly connected, or brown-out. | 1a. Check wiring. 1b. Verify power. |
| "EEEE" IN DISPLAY | 1. Program data error. | 1. Press PAR and check data set-ups. |
| ". . ." or "- . . ." IN DISPLAY | 1. Input display out of range. 2. Loss of data set-ups. | 1a. Change display resolution to "1" degree. 1b. Reduce offset value. 2a. Check data set-ups. 2b. Check for electrical disturbance. 2c. Disconnect and reconnect power. |
| DISPLAY WANDERS | 1. Loss of data set-ups. | 1a. Check data set-ups. 1b. Disconnect and reconnect power. 1c. Check for electrical disturbance. |
| JITTERY DISPLAY | 1. Electrical "Noise" in process or sensor lines. 2. Process inherently unstable. 3. Corroded or dirty thermocouple wire connections. | 1a. Increase digital filtering. 1b. Re-route sensor wires. 2. Dampen process to eliminate oscillations. 3. Clean and tighten connections. |
| "OPEN" IN DISPLAY | 1. Probe unconnected. 2. Broken or burnout probe. | 1. Connect probe. 2. Repair or obtain new probe. |
| "OL OL" IN DISPLAY | 1. Excessive positive probe temperature. | 1. Reduce temperature. |
| "UL UL" IN DISPLAY | 1. Excessive negative probe temperature. | 1. Increase temperature. |

WARRANTY/DISCLAIMER

OMEGA ENGINEERING, INC. warrants this unit to be free of defects in materials and workmanship for a period of **13 months** from date of purchase. OMEGA's WARRANTY adds an additional one (1) month grace period to the normal **one (1) year product warranty** to cover handling and shipping time. This ensures that OMEGA's customers receive maximum coverage on each product.

If the unit malfunctions, it must be returned to the factory for evaluation. OMEGA's Customer Service Department will issue an Authorized Return (AR) number immediately upon phone or written request. Upon examination by OMEGA, if the unit is found to be defective, it will be repaired or replaced at no charge. OMEGA's WARRANTY does not apply to defects resulting from any action of the purchaser, including but not limited to mishandling, improper interfacing, operation outside of design limits, improper repair, or unauthorized modification. This WARRANTY is VOID if the unit shows evidence of having been tampered with or shows evidence of having been damaged as a result of excessive corrosion; or current, heat, moisture or vibration; improper specification; misapplication; misuse or other operating conditions outside of OMEGA's control. Components in which wear is not warranted, include but are not limited to contact points, fuses, and triacs.

OMEGA is pleased to offer suggestions on the use of its various products. However, OMEGA neither assumes responsibility for any omissions or errors nor assumes liability for any damages that result from the use of its products in accordance with information provided by OMEGA, either verbal or written. OMEGA warrants only that the parts manufactured by the company will be as specified and free of defects. OMEGA MAKES NO OTHER WARRANTIES OR REPRESENTATIONS OF ANY KIND WHATSOEVER, EXPRESSED OR IMPLIED, EXCEPT THAT OF TITLE, AND ALL IMPLIED WARRANTIES INCLUDING ANY WARRANTY OF MERCHANTABILITY AND FITNESS FOR A PARTICULAR PURPOSE ARE HEREBY DISCLAIMED. LIMITATION OF LIABILITY: The remedies of purchaser set forth herein are exclusive, and the total liability of OMEGA with respect to this order, whether based on contract, warranty, negligence, indemnification, strict liability or otherwise, shall not exceed the purchase price of the component upon which liability is based. In no event shall OMEGA be liable for consequential, incidental or special damages.

CONDITIONS: Equipment sold by OMEGA is not intended to be used, nor shall it be used: (1) as a "Basic Component" under 10 CFR 21 (NRC), used in or with any nuclear installation or activity; or (2) in medical applications or used on humans. Should any Product(s) be used in or with any nuclear installation or activity, medical application, used on humans, or misused in any way, OMEGA assumes no responsibility as set forth in our basic WARRANTY/DISCLAIMER language, and, additionally, purchaser will indemnify OMEGA and hold OMEGA harmless from any liability or damage whatsoever arising out of the use of the Product(s) in such a manner.

RETURN REQUESTS/INQUIRIES

Direct all warranty and repair requests/inquiries to the OMEGA Customer Service Department. BEFORE RETURNING ANY PRODUCT(S) TO OMEGA, PURCHASER MUST OBTAIN AN AUTHORIZED RETURN (AR) NUMBER FROM OMEGA'S CUSTOMER SERVICE DEPARTMENT (IN ORDER TO AVOID PROCESSING DELAYS). The assigned AR number should then be marked on the outside of the return package and on any correspondence.

The purchaser is responsible for shipping charges, freight, insurance and proper packaging to prevent breakage in transit.

FOR **WARRANTY** RETURNS, please have the following information available BEFORE contacting OMEGA:

1. Purchase Order number under which the product was PURCHASED,
2. Model and serial number of the product under warranty, and
3. Repair instructions and/or specific problems relative to the product.

FOR **NON-WARRANTY** REPAIRS, consult OMEGA for current repair charges. Have the following information available BEFORE contacting OMEGA:

1. Purchase Order number to cover the COST of the repair,
2. Model and serial number of the product, and
3. Repair instructions and/or specific problems relative to the product.

OMEGA's policy is to make running changes, not model changes, whenever an improvement is possible. This affords our customers the latest in technology and engineering.

OMEGA is a registered trademark of OMEGA ENGINEERING, INC.

© Copyright 2006 OMEGA ENGINEERING, INC. All rights reserved. This document may not be copied, photocopied, reproduced, translated, or reduced to any electronic medium or machine-readable form, in whole or in part, without the prior written consent of OMEGA ENGINEERING, INC.

Where Do I Find Everything I Need for Process Measurement and Control? **OMEGA...Of Course!** *Shop online at omega.com*

TEMPERATURE

- Thermocouple, RTD & Thermistor Probes, Connectors, Panels & Assemblies
- Wire: Thermocouple, RTD & Thermistor
- Calibrators & Ice Point References
- Recorders, Controllers & Process Monitors
- Infrared Pyrometers

PRESSURE, STRAIN AND FORCE

- Transducers & Strain Gages
- Load Cells & Pressure Gages
- Displacement Transducers
- Instrumentation & Accessories

FLOW/LEVEL

- Rotameters, Gas Mass Flowmeters & Flow Computers
- Air Velocity Indicators
- Turbine/Paddlewheel Systems
- Totalizers & Batch Controllers

pH/CONDUCTIVITY

- pH Electrodes, Testers & Accessories
- Benchtop/Laboratory Meters
- Controllers, Calibrators, Simulators & Pumps
- Industrial pH & Conductivity Equipment

DATA ACQUISITION

- Data Acquisition & Engineering Software
- Communications-Based Acquisition Systems
- Plug-in Cards for Apple, IBM & Compatibles
- Datalogging Systems
- Recorders, Printers & Plotters

HEATERS

- Heating Cable
- Cartridge & Strip Heaters
- Immersion & Band Heaters
- Flexible Heaters
- Laboratory Heaters

ENVIRONMENTAL MONITORING AND CONTROL

- Metering & Control Instrumentation
- Refractometers
- Pumps & Tubing
- Air, Soil & Water Monitors
- Industrial Water & Wastewater Treatment
- pH, Conductivity & Dissolved Oxygen Instruments