

1 YEAR  
WARRANTY



User's Guide



Shop online at

**omega.com**

an OMEGA

www.omega.com

e-mail: [info@omega.com](mailto:info@omega.com)

ISO 9001  
Quality  
Management  
System  
STAMFORD, CT

ISO 9002  
Quality  
Control  
System  
MANCHESTER, NH

**CL123**  
**Multifunction Calibrator**

## Where Do I Find Everything I Need for Process Measurement and Control?

**OMEGA...Of Course!**

*Shop online at [www.omega.com](http://www.omega.com)*

### **TEMPERATURE**

- ☒ Thermocouple, RTD & Thermistor Probes, Connectors, Panels & Assemblies
- ☒ Wire Thermocouple, RTD & Thermistor
- ☒ Calibrators & Ice Point References
- ☒ Recorders, Controllers & Process Monitors
- ☒ Infrared Pyrometers

### **PRESSURE, STRAIN AND FORCE**

- ☒ Transducers & Strain Gages
- ☒ Load Cells & Pressure Gages
- ☒ Displacement Transducers
- ☒ Instrumentation & Accessories

### **FLOW/LEVEL**

- ☒ Rotameters, Gas Mass Flowmeters & Flow Computers
- ☒ Air Velocity Indicators
- ☒ Turbine/Paddlewheel Systems
- ☒ Totalizers & Batch Controllers

### **pH/CONDUCTIVITY**

- ☒ pH Electrodes, Testers & Accessories
- ☒ Benchtop/Laboratory Meters
- ☒ Controllers, Calibrators, Simulators & Pumps
- ☒ Industrial pH & Conductivity Equipment

### **DATA ACQUISITION**

- ☒ Data Acquisition & Engineering Software
- ☒ Communications-Based Acquisition Systems
- ☒ Plug-in Cards for Apple, IBM & Compatibles
- ☒ Datalogging Systems
- ☒ Recorders, Printers & Plotters

### **HEATERS**

- ☒ Heating Cable
- ☒ Conduit & Strip Heaters
- ☒ Immersion & Band Heaters
- ☒ Flexible Heaters
- ☒ Laboratory Heaters

### **ENVIRONMENTAL**

#### **MONITORING AND CONTROL**


- ☒ Metering & Control Instrumentation
- ☒ Refractometers
- ☒ Pumps & Tubing
- ☒ Air, Soil & Water Monitors
- ☒ Industrial Water & Wastewater Treatment
- ☒ pH, Conductivity & Dissolved Oxygen Instruments

ME690/0501


# Table of Contents



<b>I. PANEL DESCRIPTION .....</b>	<b>1</b>
<b>II. OPERATING INSTRUCTION .....</b>	<b>6</b>
1. MA OUTPUT.....	6
1a. General Operation 4 - 20mA .....	6
1b. Select 0 - 20mA or 0 - 24mA .....	8
1c. Enter a value less than 1.....	9
2. MV, V OUTPUT.....	9
2a. General Operation 0 - 100mV.....	9
2b. Select 0 - 1V or 0 - 12V.....	11
2c. Enter a value less than 1.....	12
3. HZ, FREQUENCY OUTPUT .....	12
4a. General Operation.....	14
4b. Select °C, or °F.....	16
4c. Select K, J, E, or T type Thermocouple .....	17
4d. Enter a Negative Temperature.....	18
5. % INPUT IN THE MA, MV, V FUNCTIONS.....	19
6. EASY STEP IN THE MA, MV, AND V FUNCTIONS .....	21
7. AUTO RAMP IN THE MA, MV, AND V FUNCTION .....	23
8. HOW TO GET NEGATIVE OUTPUT.....	26
<b>III. ELECTRICAL SPECIFICATION .....</b>	<b>27</b>
<b>IV. USE THE AC ADAPTER.....</b>	<b>32</b>
<b>V. USE EXTERNAL BATTERY PACK.....</b>	<b>33</b>
<b>VI. BATTERY REPLACEMENT.....</b>	<b>34</b>

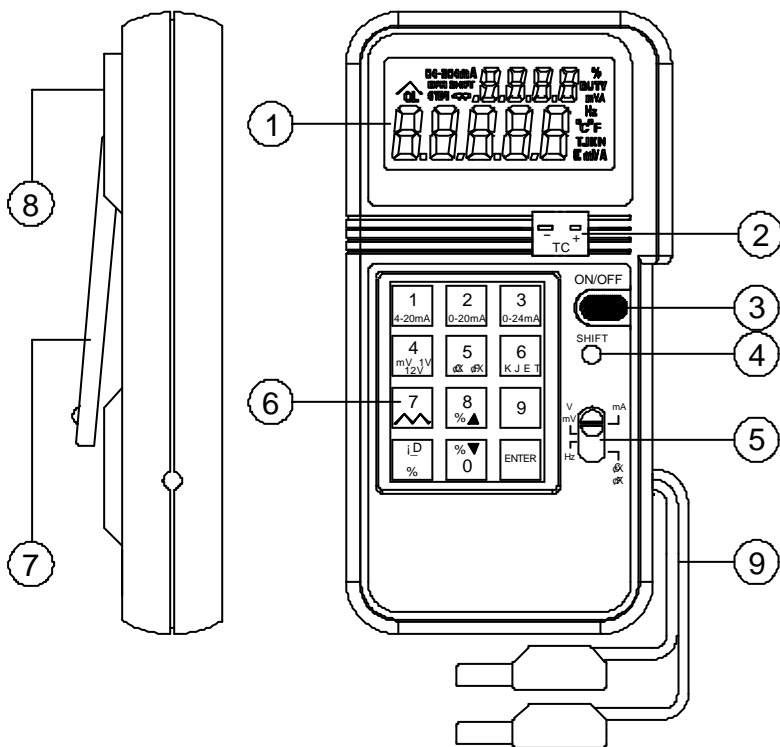
# I. Panel Description

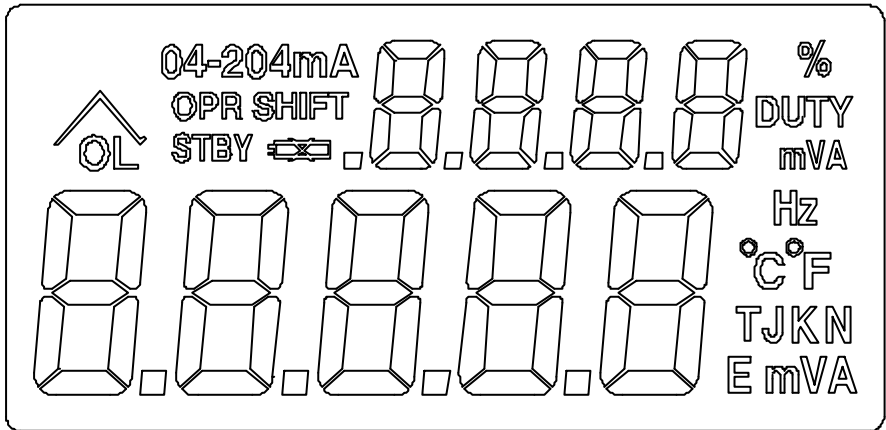


- |                           |                                |
|---------------------------|--------------------------------|
| 1. LCD DISPLAY            | 6. NUMERICAL & FUNCTION KEYPAD |
| 2. THERMOCOUPLE SOCKET    | 7. STAND                       |
| 3. ON/OFF BUTTON          | 8. AC ADAPTOR INPUT SOCKET     |
| 4. SHIFT BUTTON           | 9. OUTPUT LEADS                |
| 5. FUNCTION SELECT SWITCH |                                |



1. mVAHz: Units
2. 04-204mA : Range of mA
3. %: Percentage
4. JKET: Thermocouple type
5.  : Ramp
6. OPR : Operate, Output, Normal
7. OL: Overload, Output, Abnormal
8. STBY: Standby, Internal Calibration in Progress
9. SHIFT: Select SHIFT functions
10.  Battery low

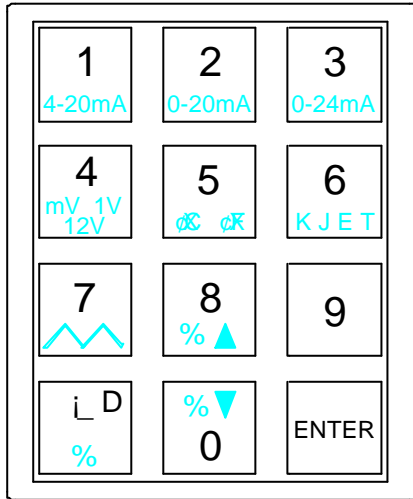


1




Press SHIFT button, and then press one of these three buttons to select desired mA range

2.

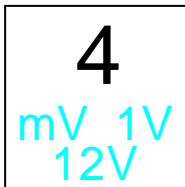

Press SHIFT button, then press this button to select desired mV or V range

3.

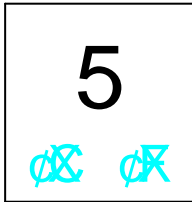


Press SHIFT button, then press this button to select ° C or ° F

4.




Press SHIFT button, then press this button to select desired type of thermocouple.

5.

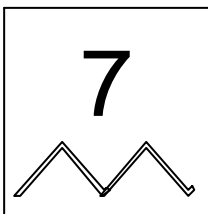


Press SHIFT button, then press this button to perform auto-ramp function.  
To stop the auto-ramp function, press this button again

6.

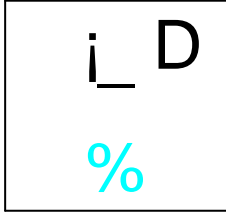

Press this button to enter negative temperature. Or press SHIFT button, then press this button first to enter percentage in the mA, mV, and V functions.

7.

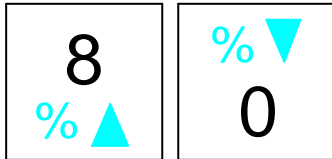

While the calibrator is in the SHIFT mode, and the percentage is entered, press this button to increment %.

8.



Always press this button to complete the entry of numbers.




## II. Operating Instruction

### 1.mA Output

#### 1a. General Operation 4 - 20mA

- 1 Turn the power on, and wait until the STBY symbol disappears (about 1 min.)
- 2 Plug the test leads into the output connectors of calibrator accordingly (Black to black, red to red). Attach alligator clip if necessary.
- 3 Move the sliding switch to mA position
- 4 Press the keypad (including the decimal point) to enter the value of mA directly.
- 5 Using the test leads or alligator clips, touch or clip on the terminals to be calibrated.

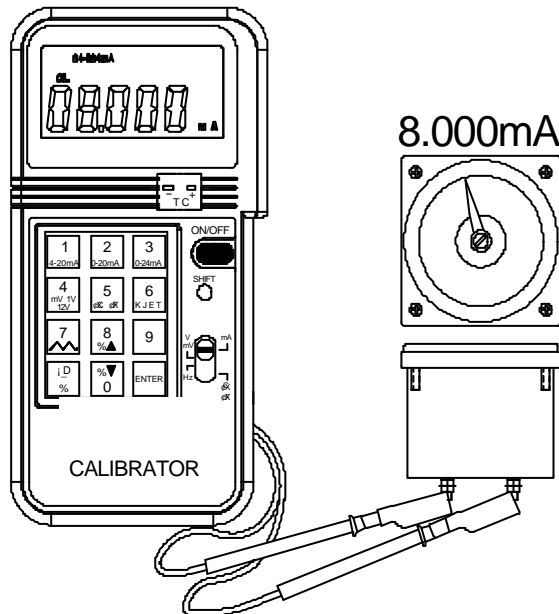



Note: Always waits until STBY (standby) symbol in the LCD disappears before any operation.

Note: Maximum 5 digits can be entered. If users enter less than 5 digits (1 to 4 digits), users must press ENTER button to indicate the end of entry. If users enter 5 or more digits, calibrator will automatically end the entry and output specified value current.

1b. Select 0 - 20mA or 0 - 24mA

The default setting for mA function is 4 - 20mA. But users can select 0 - 20mA or 0 - 24 mA by pressing the SHIFT button to enter the SHIFT mode. Then press the NUMBER 2 or NUMBER 3 button to select desired DC current range. After desired range is selected, press the shift button to exit the SHIFT mode. Corresponding current range symbol will be displayed in the LCD.

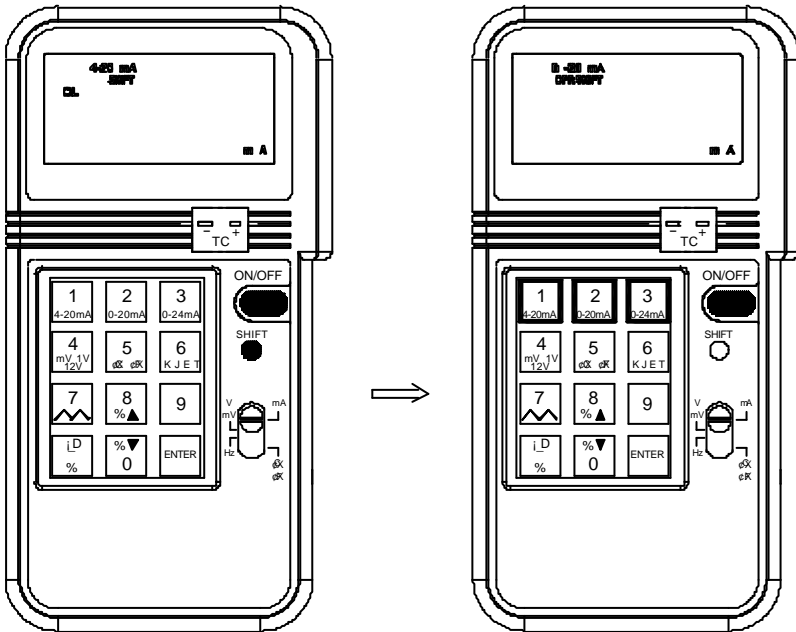

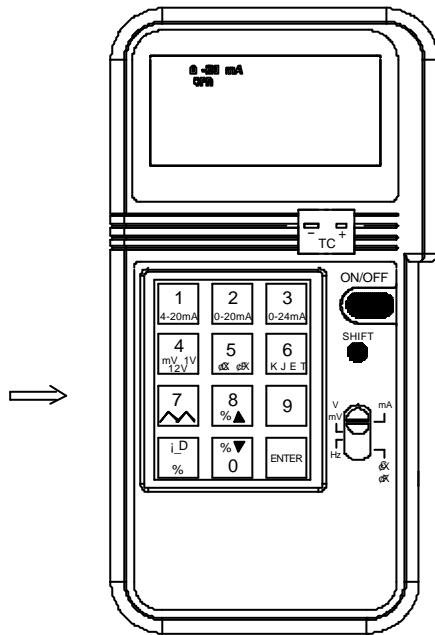

1c. Enter a value less than 1

In the mA functions, the standard way to enter a value less than 1 is to press leading 0 before pressing the decimal point. Though the decimal point can be entered, the decimal point will not be shown in the LCD.

2. mV, V Output


2a. General Operation 0 - 100mV

1. Turn the power on, &

the STBY symbol disappears

(about 2 min.).

2. Plug the test leads into the output connectors of calibrator accordingly (Black to black, red to red). Attach alligator clip if necessary.
3. Move the sliding switch to mV, V position
4. Press the keypad (including the decimal point) to enter the value of mA directly.
5. Using the test leads or alligator clips, touch or clip on the terminals to be calibrated.


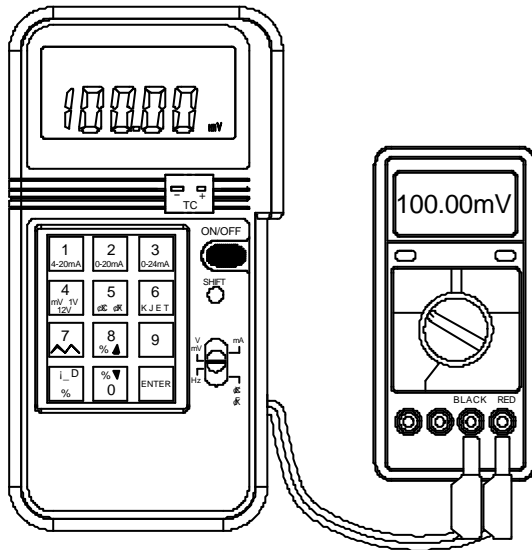


Note: Always wait until STBY (standby) symbol in the LCD to disappear before any operation.

Note: Maximum 5 digits can be entered. If users enter less than 5 digits (1 to 4 digits), users must press ENTER button to indicate the end of entry. If users enter 5 or more digits, calibrator will automatically end the entry and output specified value current.

2b. Select 0 - 1V or 0 - 12V

The default setting for mV, V function is 0 - 100.00mV. Users can select 0 - 1.0000V or 0 -12.000V by pressing the SHIFT button to enter SHIFT mode. Then press the NUMBER 4 button repeatedly to select desired DC voltage range. After desired range is selected, press the SHIFT button again to exit the SHIFT mode. Corresponding voltage range symbol will be displayed in the LCD.

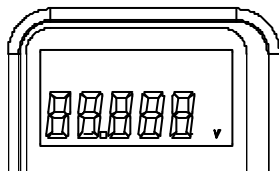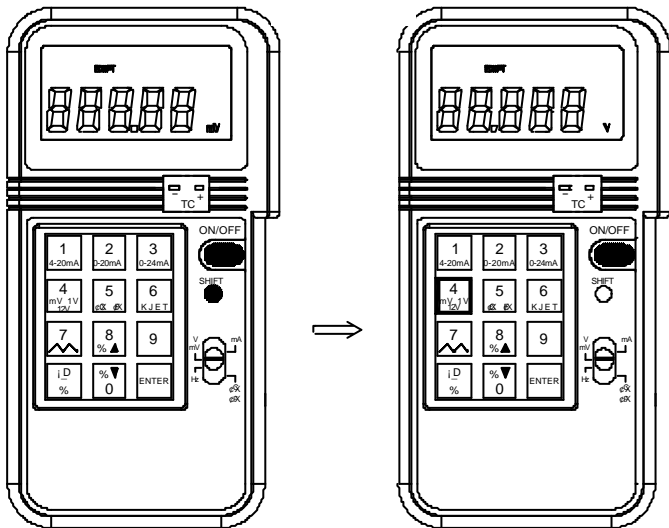


2c. Enter a value less than 1

In the mV/V functions, the standard way to enter a value less than 1 is to press the leading 0 before pressing the decimal point. Though the decimal point can be entered first, the decimal point will not be shown in the LCD.

3. Hz, Frequency Output

1. Turn the power on, then plug the test leads into the output connectors of calibrator accordingly (Black to black, red to red). Attach alligator clip if necessary.
2. Move the sliding switch to Hz position

3. Press the keypad (excluding the decimal point) to enter the value of Hz directly.
4. Using the test leads or alligator clips, touch or clip on the terminals to be calibrated.
5. Because not all the frequencies are available between 126 to 62500Hz, calibrator will automatically adjust and display the users input value to a frequency, which is available and always larger or equal to users input.

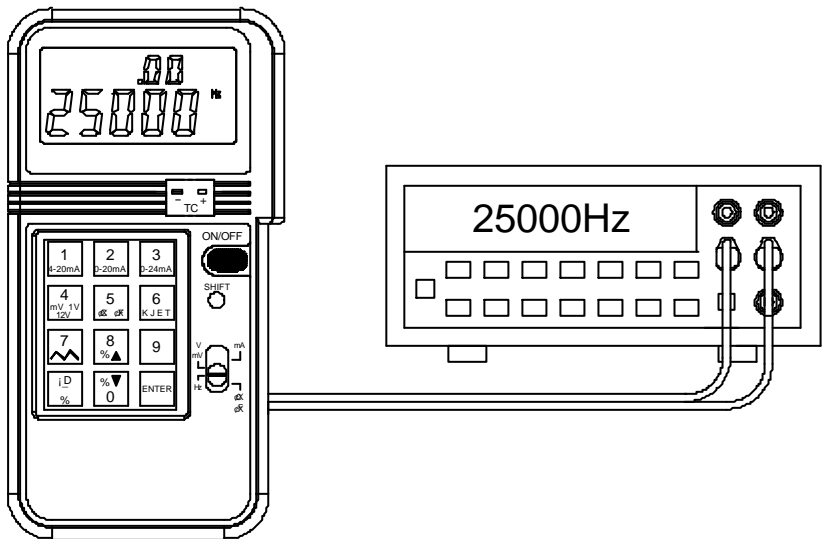


Note: The resolution of Hz function is 1 Hz. For the range 1-125Hz, all the frequencies in between are available. But for the range 126 - 62500Hz, not all the frequencies are available (total 604 frequencies available). Please refer to section III Electrical Specifications for available frequencies.


#### 4. Thermocouple Calibration of °C, °F.



#### 4a. General Operation

1. Turn the power on, and wait until the STBY symbol disappears (about 1 min.).
2. Plug the corresponding connector (K-type connector for K-type thermocouple, J-type connector for J-type thermocouple, ...) into TC terminals of calibrator and thermometer to be calibrated.
3. Move the sliding switch to °C, °F position
4. Press the keypad (including the minus - button) to enter the value of Temperature directly.

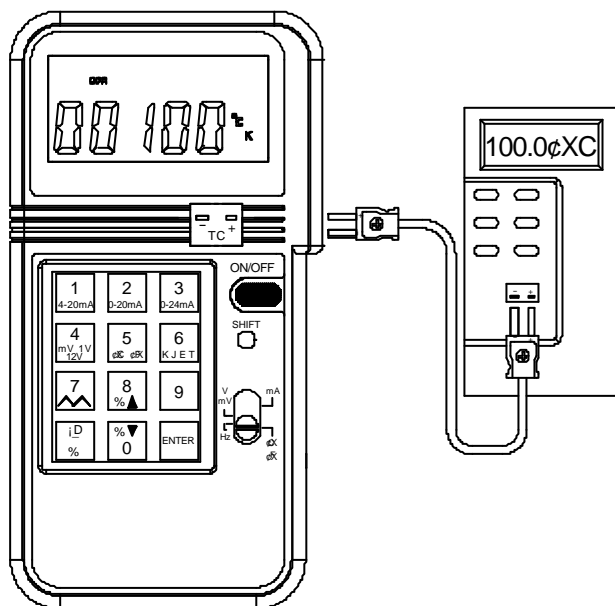

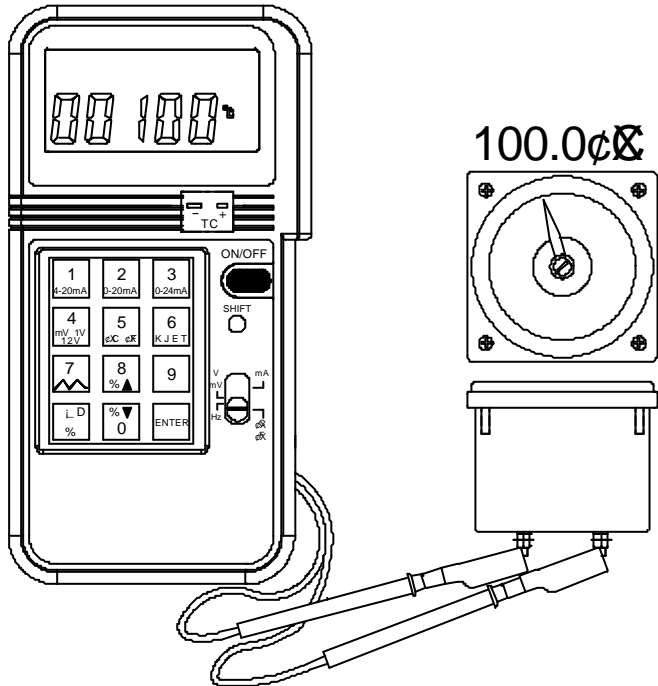


Note: Users can plug the connector into the TC terminals of calibrator even before the power is turned on for better thermal equilibrium between the TC terminal and thermocouple connector.




Note: Only in the °C and °F functions, the negative values are allowed to be entered. To enter negative temperature, press the minus "-" button first.


Note: Maximum 4 digits (including the "-" sign) can be entered. If users enter less than 4 digits (1 to 3 digits), users must press ENTER button to indicate the end of entry. If users enter 4 or more digits, calibrator will automatically end the entry and output specified value of temperature.

4b. Select °C, or °F

Users can select °C or °F by pressing the shift button to enter SHIFT mode. Then press the NUMBER 5 button repeatedly to select desired temperature unit. After desired unit is selected, press the SHIFT button again to exit the SHIFT mode. Corresponding voltage °C or °F symbol will be displayed in the LCD.

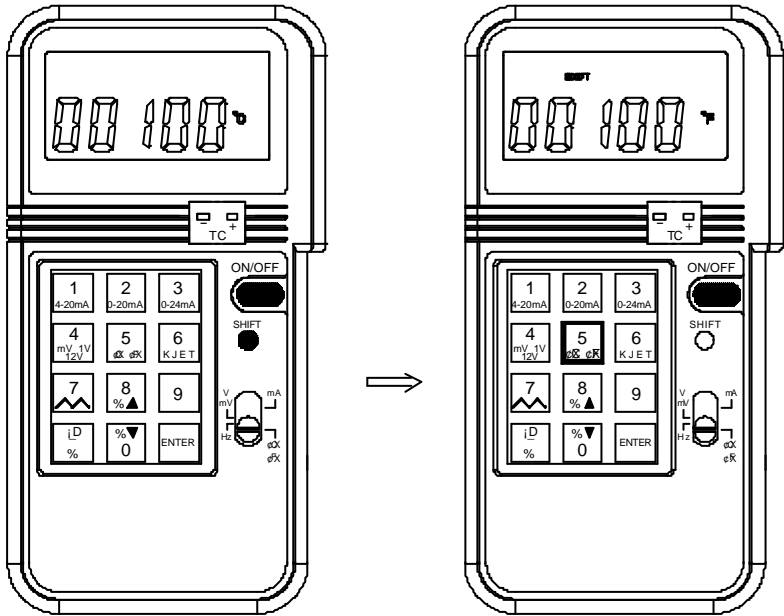

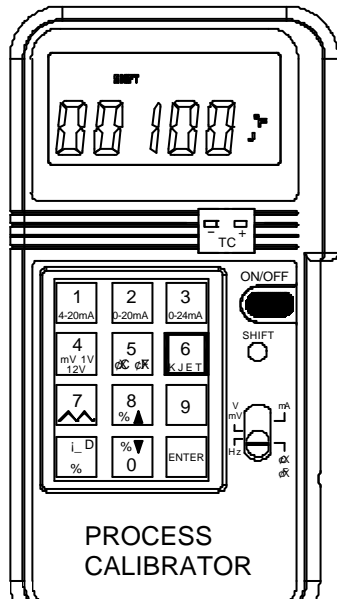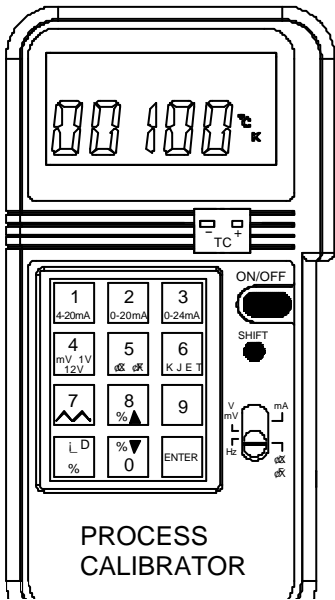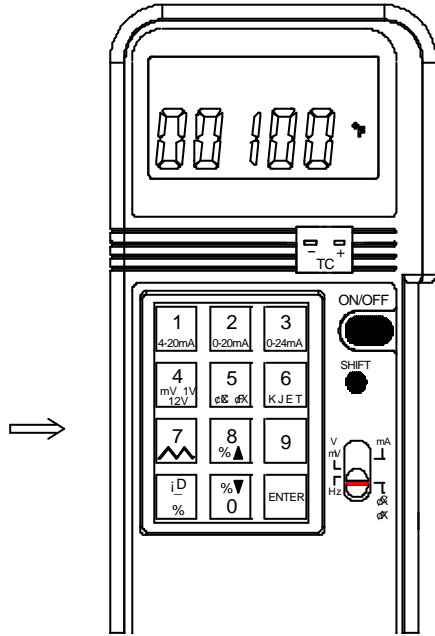

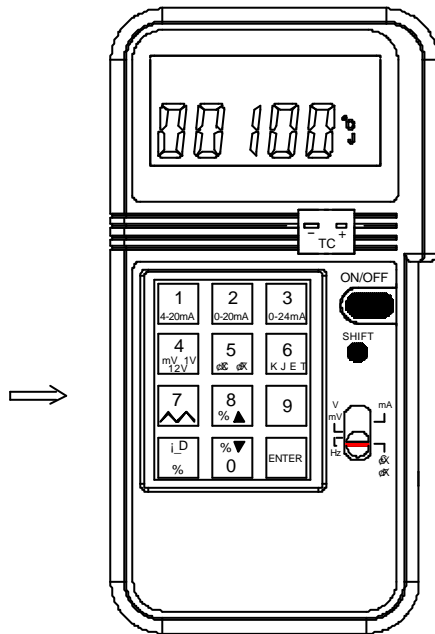

#### 4d. Enter a Negative Temperature

The resolution of temperature is 1 degree, so the decimal point is used a minus "-" sign. To enter a negative temperature, press the "-" button first.

## 5. % input in the mA, mV, V functions

In the mA, mV, or V function, users can enter percentage. To enter percentage (%)

1. Users press the shift button first, then SHIFT symbol will be displayed in the LCD.
2. Press % button first, then press the number (no decimal number, the % resolution is 1%).
3. After percentage is entered, the percentage will be displayed in the upper LCD, and the corresponding value will be displayed in the lower LCD.
4. The corresponding value is calculated based upon the range selected.

4-20mA: 1% = 0.16mA

0-20mA: 1% = 0.2mA


0-24mA: 1% = 0.24mA


0-100mV: 1% = 1mV

0-1V: 1% = 0.01V

0-12V: 1% = 0.12V

5. To exit the percentage-input mode, press the SHIFT button again.
6. After the SHIFT button is pressed, the upper LCD will become blank, while the lower LCD retains its last value.

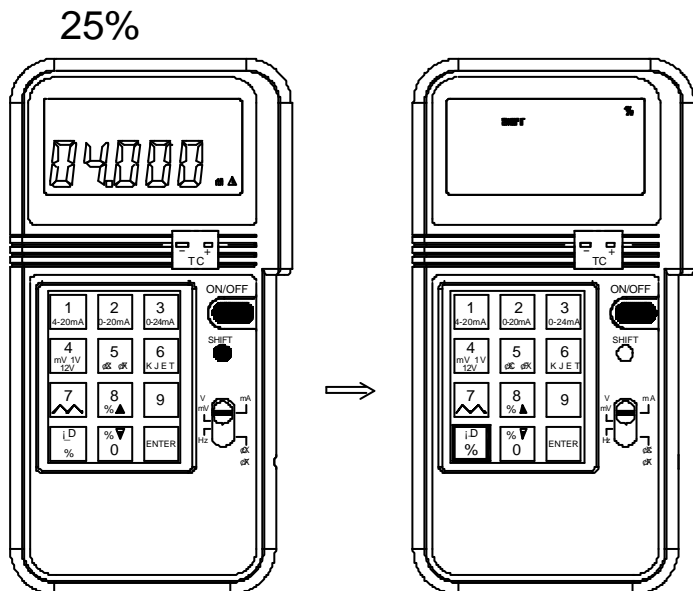

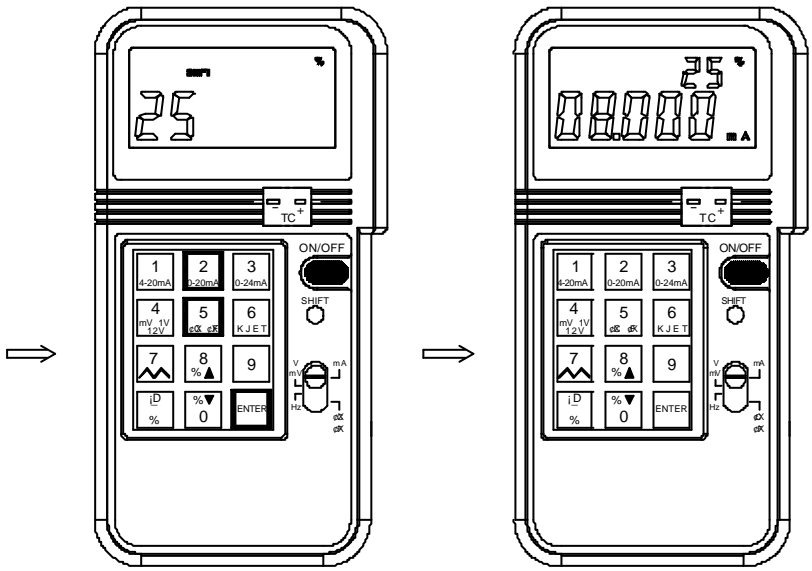

## 6. Easy Step in the mA, mV, and V Functions


While the percentage is entered and calibrator is still in the SHIFT mode, users can step up or down by the percentage entered. The maximum percentage is 100% while the minimum percentage is 0%. If the next step up or down exceeds the maximum or minimum percentage, the percentage will stay in the previous step.

Example 1: Step Up and Down(25%):


25% -> 50% -> 75% -> 100% -> 75% -> 50% -> 25% -> 0% -> 25%

Example 2: Step Up and Down(30%):

30% -> 60% -> 90% -> 60% -> 30% -> 0% -> 30%

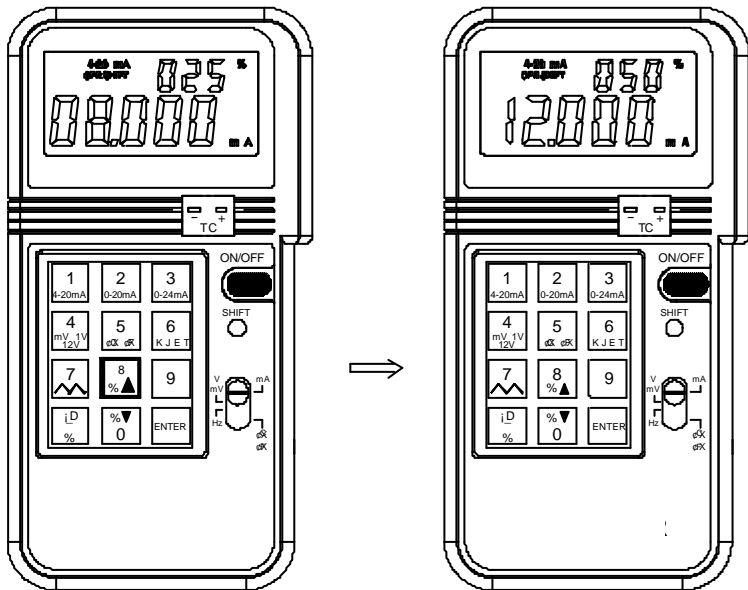




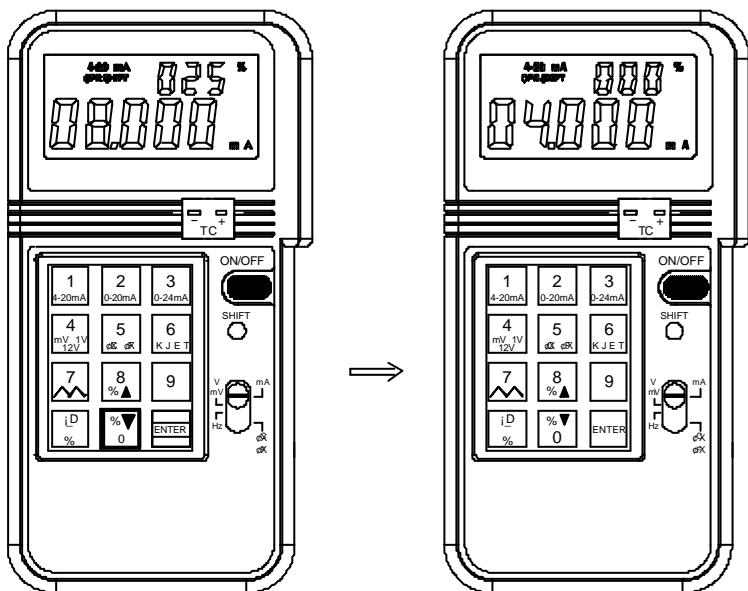

## 7. Auto Ramp in the mA, mV, and V functions



In the mA, mV, and V function, auto ramp function is available to the users. To start the ramp function:



1. Press the SHIFT button to enter the SHIFT mode.
2. Press the NUMBER 7 key to start
3. Ramp function increment from 0% to 100%, then decrements from 100% to 0% repeatedly. The resolution of each step is 1% (with respect the range selected) at an interval of 0.08 seconds. So it takes 8 seconds to ramp from 0 to 100%.
4. To temporarily stop the ramp function, press the NUMBER 7 key, and the output will stay at the value when the NUMBER 7 key is pressed. These features will facilitate the checking of trigger point of tested device, such as valve controller.
5. To restart again, press the NUMBER 7 button again.
6. To return to the regular output mode, press the SHIFT button again when ramp function is stopped.

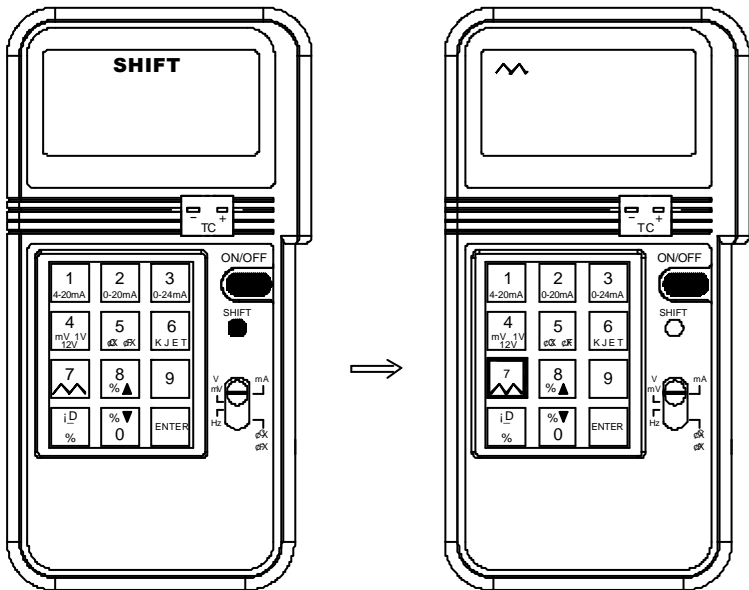

1% per STEP

100%

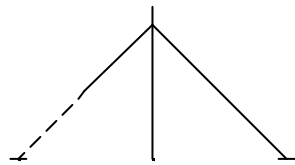
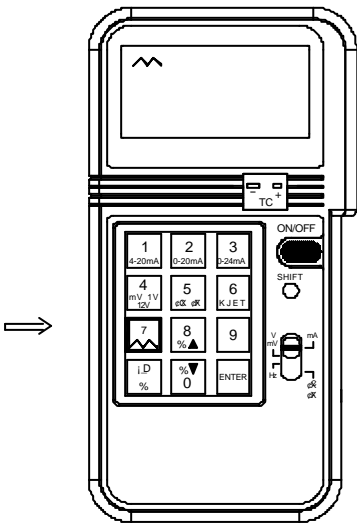


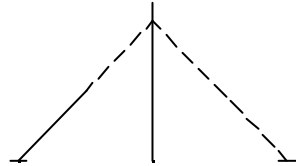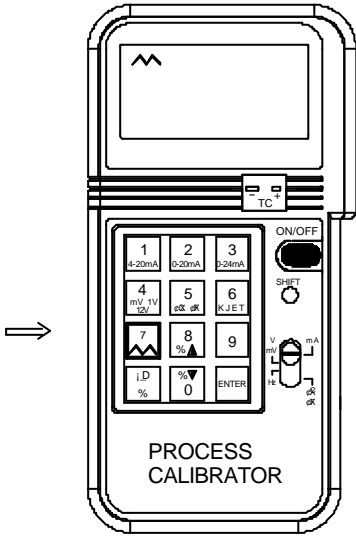

Note: Do not press any button while the calibrator is performing the ramp function (except NUMBER 7 button to stop the ramp function).

### 8. How to Get Negative Output

If negative output (mA, mV, or V) is needed, users can achieve it by interchange the connection of test leads.

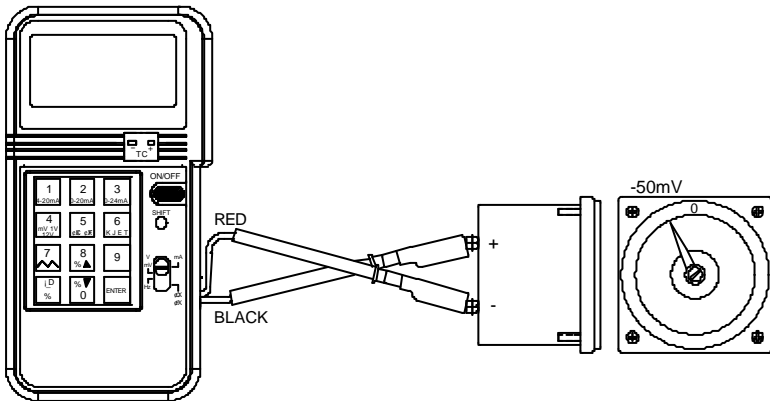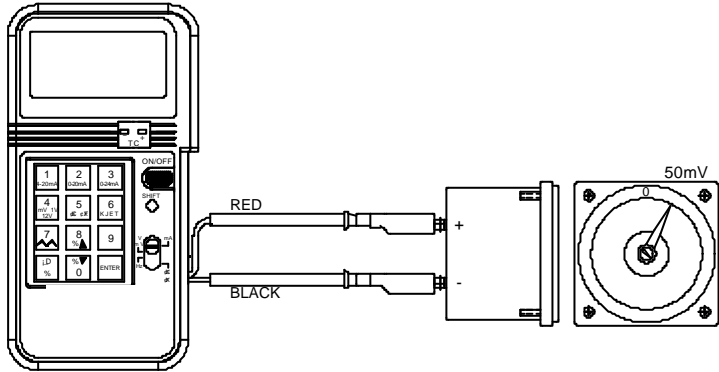

III. Electrical Specification (23? ± 5? , 5 minutes after power is on)

mA DC Current (1KΩ Max. Load, 24V Loop Supply)

Range	Resolution	Accuracy
4 - 20mA, 0 - 20mA, 0 -24 mA	1μA	± 0.025% ±3μA

Beeper warning when output is open and specified current output > 1mA

mV, V DC Voltage (1mA Supply Current)

Range	Resolution	Accuracy
0 - 100.00mV	10μV	± 0.05% ± 30μV
0 - 10.000V	1mV	± 0.05% ± 3mV
0 - 1.0000V	100μV	± 0.05% ± 300μV

Beeper warning when output is short and specified voltage output > 10mV

K, J, S, T type Thermocouples( 1? ,1? Resolution,1KΩ load Min. )

Range	Accuracy	Range	Accuracy
K: -200 to 0?	± 1.1?	K: -328 to 32?	± 2.0?
K: 0 to 1370?	± 0.8?	K: 32 to 2400?	± 1.5?
J: -100 to 0?	± 0.9?	J: -148 to 32?	± 1.6?
J: 0 to 760?	± 0.7?	J: 32 to 1400?	± 1.2?
S: 0 to 250?	± 1.4?	S: 32 to 482?	± 2.2?
S: 250 to 1760?	± 1.0?	S: 482 to 3200?	± 1.8?
T: -200 to 0?	± 1.0?	T: -328 to 32?	± 1.8?
T: 0 to 400?	± 0.8?	T: 32 to 752?	± 1.5?

Frequency (1 - 125Hz, 1K $\Omega$  Load Min.)

Range	Resolution	Accuracy
1 - 125 Hz	1 Hz	$\pm 0.04\text{Hz}$

Available Frequencies

(126 - 62500Hz, Accuracy  $\pm 0.01\% \pm 0.04\text{Hz}$ , 1K $\Omega$  Load Min):

126.00	127.03	128.07	129.13	130.20	131.30	132.41	133.54
134.12	135.28	136.46	137.06	138.27	139.50	140.13	141.40
142.04	143.34	144.00	145.34	146.02	147.40	148.10	149.52
150.24	151.69	152.43	153.18	154.70	155.47	156.25	157.03
158.62	159.43	160.25	161.08	162.76	163.61	164.47	165.34
166.22	167.11	168.01	169.83	170.76	171.70	172.65	173.61
174.58	175.56	176.55	177.55	178.57	179.59	180.63	181.68
182.74	183.82	184.91	186.01	187.12	188.25	189.39	190.54
191.71	192.90	194.09	195.31	196.54	197.78	199.04	200.32
201.61	202.92	204.24	205.59	206.95	208.33	209.73	211.14
212.58	214.04	215.51	217.01	218.53	220.07	221.63	223.21
224.82	226.44	228.10	229.77	231.48	233.20	234.96	236.74
238.54	240.38	242.24	244.14	246.06	248.01	250.00	252.01
254.06	256.14	258.26	260.41	262.60	264.83	267.09	269.39
271.73	274.12	276.54	279.01	281.53	284.09	286.69	289.35
292.05	294.81	297.61	300.48	303.39	306.37	309.40	312.50
315.65	318.87	322.16	325.52	328.94	332.44	336.02	339.67
343.40	347.22	351.12	355.11	359.19	363.37	367.64	372.02
376.50	381.09	385.80	390.62	395.56	400.64	405.84	411.18
416.66	422.29	428.08	434.02	440.14	446.42	452.89	459.55
466.41	473.48	480.76	488.28	490.19	492.12	494.07	496.03
498.00	500.00	502.00	504.03	506.07	508.13	510.20	512.29
514.40	516.52	518.67	520.83	523.01	525.21	527.42	529.66
531.91	534.18	536.48	538.79	541.12	543.47	545.85	548.24
550.66	553.09	555.55	558.03	560.53	563.06	565.61	568.18

570.77	573.39	576.03	578.70	581.39	584.11	586.85	589.62
592.41	595.23	598.08	600.96	603.86	606.79	609.75	612.74
615.76	618.81	621.89	625.00	628.14	631.31	634.51	637.75
641.02	644.32	647.66	651.04	654.45	657.89	661.37	664.89
668.44	672.04	675.67	679.34	683.06	686.81	690.60	694.44
698.32	702.24	706.21	710.22	714.28	718.39	722.54	726.74
730.99	735.29	739.64	744.04	748.50	753.01	757.57	762.19
766.87	771.60	776.39	781.25	786.16	791.13	796.17	801.28

806.45 811.68 816.99 822.36 827.81 833.33 838.92 844.59  
 850.34 856.16 862.06 868.05 874.12 880.28 886.52 892.85  
 899.28 905.79 912.40 919.11 925.92 932.83 939.84 946.96  
 954.19 961.53 968.99 976.56 984.25 992.06  
 1000.00 1008.06 1016.26 1024.59 1033.05 1041.66 1050.42 1059.32  
 1068.37 1077.58 1086.95 1096.49 1106.19 1116.07 1126.12 1136.36  
 1146.78 1157.40 1168.22 1179.24 1190.47 1201.92 1213.59 1225.49  
 1237.62 1250.00 1262.62 1275.51 1288.65 1302.08 1315.78 1329.78  
 1344.08 1358.69 1373.62 1388.88 1404.49 1420.45 1436.78 1453.48  
 1470.58 1488.09 1506.02 1524.39 1543.20 1562.50 1582.27 1602.56  
 1623.37 1644.73 1666.66 1689.18 1712.32 1736.11 1760.56 1785.71  
 1811.59 1838.23 1865.67 1893.93 1923.07 1953.12 1960.78 1968.50  
 1976.28 1984.12 1992.03 2000.00 2008.03 2016.12 2024.29 2032.52  
 2040.81 2049.18 2057.61 2066.11 2074.68 2083.33 2092.05 2100.84  
 2109.70 2118.64 2127.65 2136.75 2145.92 2155.17 2164.50 2173.91  
 2183.40 2192.98 2202.64 2212.38 2222.22 2232.14 2242.15 2252.25  
 2262.44 2272.72 2283.10 2293.57 2304.14 2314.81 2325.58 2336.44  
 2347.41 2358.49 2369.66 2380.95 2392.34 2403.84 2415.45 2427.18  
 2439.02 2450.98 2463.05 2475.24 2487.56 2500.00 2512.56 2525.25  
 2538.07 2551.02 2564.10 2577.31 2590.67 2604.16 2617.80 2631.57  
 2645.50 2659.57 2673.79 2688.17 2702.70 2717.39 2732.24 2747.25  
 2762.43 2777.77 2793.29 2808.98 2824.85 2840.90 2857.14 2873.56  
 2890.17 2906.97 2923.97 2941.17 2958.57 2976.19 2994.01 3012.04  
 3030.30 3048.78 3067.48 3086.41 3105.59 3125.00 3144.65 3164.55  
 3184.71 3205.12 3225.80 3246.75 3267.97 3289.47 3311.25 3333.33  
 3355.70 3378.37 3401.36 3424.65 3448.27 3472.22 3496.50 3521.12  
 3546.09 3571.42 3597.12 3623.18 3649.63 3676.47 3703.70 3731.34  
 3759.39 3787.87 3816.79 3846.15 3875.96 3906.25 3937.00 3968.25  
 4000.00 4032.25 4065.04 4098.36 4132.23 4166.66 4201.68 4237.28  
 4273.50 4310.34 4347.82 4385.96 4424.77 4464.28 4504.50 4545.45  
 4587.15 4629.62 4672.89 4716.98 4761.90 4807.69 4854.36 4901.96  
 4950.49 5000.00 5050.50 5102.04 5154.63 5208.33 5263.15 5319.14  
 5376.34 5434.78 5494.50 5555.55 5617.97 5681.81 5747.12 5813.95  
 5882.35 5952.38 6024.09 6097.56 6172.83 6250.00 6329.11 6410.25  
 6493.50 6578.94 6666.66 6756.75 6849.31 6944.44 7042.25 7142.85  
 7246.37 7352.94 7462.68 7575.75 7692.30 7812.50 7936.50 8064.51  
 8196.72 8333.33 8474.57 8620.68 8771.92 8928.57 9090.90 9259.25  
 9433.96 9615.38 9803.92  
 10000.00 10204.08 10416.66 10638.29 10869.56 11111.11 11363.63  
 11627.90 11904.76 12195.12 12500.00 12820.51 13157.89 13513.51  
 13888.88 14285.71 14705.88 15151.51 15625.00 16129.03 16666.66  
 17241.37 17857.14 18518.51 19230.76 20000.00 20833.33 21739.13  
 22727.27 23809.52 25000.00 26315.78 27777.77 29411.76 31250.00




33333.33 35714.28 38461.53 41666.66 45454.54 50000.00 55555.55  
62500.00

General Specification:	
Battery Type:	9V Alkaline Battery
Power Consumption:	60mA - 180mA (depends on output)
Display:	4 and 5 Digits
Operating Temperature:	0 to 50°C ( 32 to 122 °F)
Operating Humidity:	Less than 85% relative
Storage Temperature:	-20 to 60° C (-4 to 140 °F)
Storage Humidity:	Less than 85% relative
Dimension:	88 x 168 x 26 mm (3.46" x 6.61" x 1.03")
Weight:	330 g / 11.63 oz
Accessories:	Carrying case x 1 Users Manual x 1 K type thermocouple connector External Battery Pack 6 1.5V AA Batteries 9 V battery x 1 Alligator clip x 1

#### IV. Use the AC adapter



If long term usage of the calibrator is required, AC adapter can be used. The 12V AC terminal is located in the back of the calibrator. The voltage should be regulated between 9 to 15V.

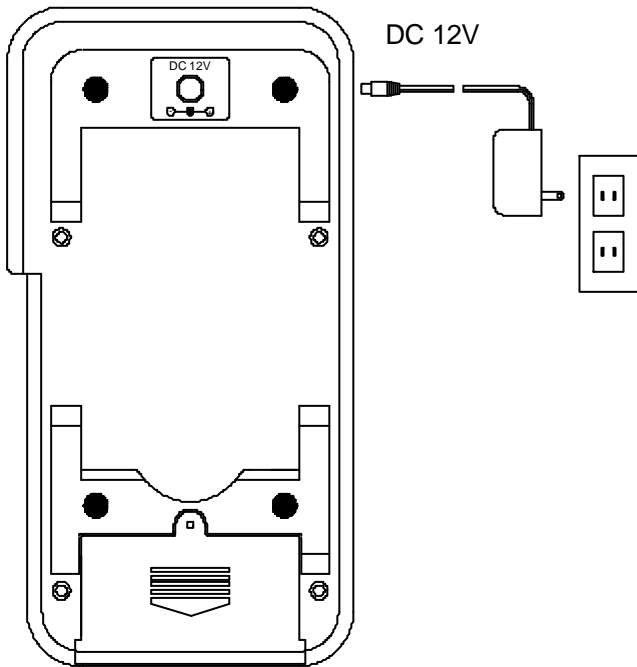


## V. Use External Battery Pack

An external battery pack is included for a longer period usage. The external battery pack needs to be packed with 6 pieces of 1.5 volts AA batteries. To use the external battery pack, plug into the AC terminals located in the back of the calibrator.

### BATTERY HOLDER

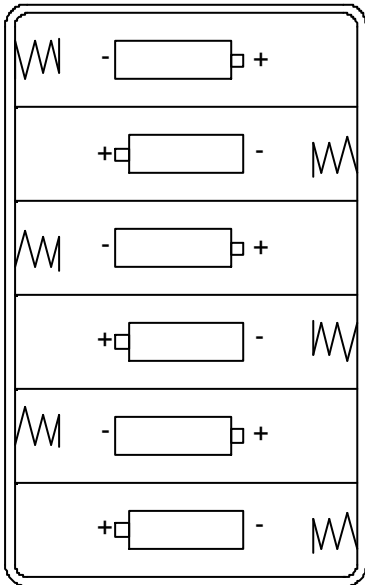


### BATTERIES 6x1.5V AA

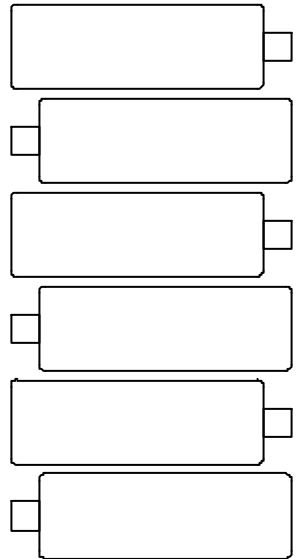

## VI. Battery Replacement

When the low battery symbol is displayed on LCD, follow the following procedures to replace the battery.

- 1 Turn off the calibrator by pushing the On/Off button.
- 2 Remove the screw of the battery compartment cover and remove the battery compartment cover.
- 3 Replace the old 9V battery with a new alkaline 9V battery.
- 4 Replace the battery compartment cover and fasten the screw.

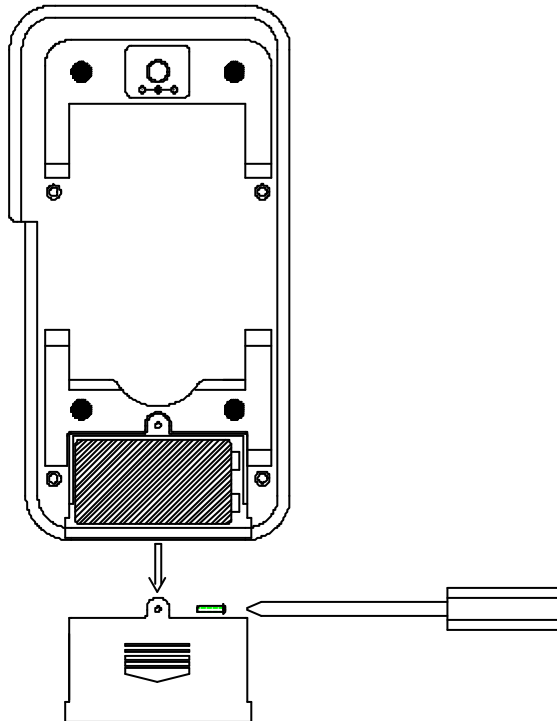

**Note: In the mA, mV, V, °C, and °F functions, status of low battery is detected. While in the Hz function, status of low battery is not**

**detected.**



OMEGAnet® Online Service  
www.omega.com

Internet e-mail  
info@omega.com

#### Servicing North America:

**USA:**  
ISO 9001 Certified One Omega Drive, Box 4047  
Stamford CT 06907-0047  
Tel: (203) 359-1860 FAX: (203) 359-7700  
e-mail: info@omega.com

**Canada:**  
978 Berger  
Laval (Québec) H7L 5A1  
Tel: (514) 856-6828 FAX: (514) 856-6886  
e-mail: info@omega.ca

#### For immediate technical or application assistance:

**USA and Canada:** Sales Service: 1-800-826-6342 / 1-800-TC-OMEGA®  
Customer Service: 1-800-622-2376 / 1-800-622-BEST®  
Engineering Service: 1-800-872-9436 / 1-800-USA-WHEN®  
TELEX: 996404 EASYLINK; 62968834 CABLE OMEGA

**Mexico:** En Español: (001) 203-359-7803 e-mail: espanol@omega.com  
FAX: (1 001) 203-359-7807 info@omega.com.mx

#### Servicing Europe:

**Belarus:** Postbus 8034, 1180 LA Amstelveen, The Netherlands  
Tel: +31 (0)20 2472121 FAX: +31 (0)20 6434643  
Toll Free in Belarus: 0800 099344  
e-mail: nl@omega.com

**Czech Republic:** Rudé armády 1868, 733 01 Karvínó 8  
Tel: +420 (0)69 6311899 FAX: +420 (0)69 6311114  
Toll Free: 0800-1-66242 e-mail: czech@omega.com

**France:** 5, rue Denis Papin, 78190 Trappes  
Tel: +33 (0)130 621 400 FAX: +33 (0)130 699 120  
Toll Free in France: 0800-4-06342  
e-mail: france@omega.com

**Germany/Austria:** Daimlerstrasse 26, D-75392 Deckerspfaffen, Germany  
Tel: +49 (0)7056 9388-0 FAX: +49 (0)7056 9398-29  
Toll Free in Germany: 0800 639 7678  
e-mail: germany@omega.com

**United Kingdom:** One Omega Drive, River Bend Technology Centre  
ISO 9002 Certified Northbank, Irlam, Manchester  
M44 3BD United Kingdom  
Tel: +44 (0)161 777 6611 FAX: +44 (0)161 777 6622  
Toll Free in United Kingdom: 0800-488-488  
e-mail: sales@omega.co.uk

It is the policy of OMEGA to comply with all worldwide safety and EMC/EMI regulations that apply. OMEGA is constantly pursuing certification of its products to the European New Approach Directives. OMEGA will add the CE mark to every appropriate device upon certification.

The information contained in this document is believed to be correct, but OMEGA Engineering, Inc. accepts no liability for any errors it contains, and reserves the right to alter specifications without notice.

**WARNING:** These products are not designed for use in, and should not be used for, patient-connected applications.

## WARRANTY/DISCLAIMER

OMEGA ENGINEERING, INC. warrants this unit to be free of defects in materials and workmanship for a period of **13 months** from date of purchase. OMEGA's Warranty adds an additional one (1) month grace period to the normal **one (1) year product warranty** to cover handling and shipping time. This ensures that OMEGA's customers receive maximum coverage on each product.

If the unit malfunctions, it must be returned to the factory for evaluation. OMEGA's Customer Service Department will issue an Authorized Return (AR) number immediately upon phone or written request. Upon examination by OMEGA, if the unit is found to be defective, it will be repaired or replaced at no charge. OMEGA's WARRANTY does not apply to defects resulting from any action of the purchaser, including but not limited to mishandling, improper interfacing, operation outside of design limits, improper repair, or unauthorized modification. This WARRANTY is VOID if the unit shows evidence of having been tampered with or shows evidence of having been damaged as a result of excessive corrosion; or current, heat, moisture or vibration; improper specification; misapplication; misuse or other operating conditions outside of OMEGA's control. Components which wear are not warranted, including but not limited to contact points, fuses, and triacs.

OMEGA is pleased to offer suggestions on the use of its various products. However, OMEGA neither assumes responsibility for any omissions or errors nor assumes liability for any damage that result from the use of its products in accordance with information provided by OMEGA, either verbal or written. OMEGA warrants only that the parts manufactured by it will be as specified and free of defects. OMEGA MAKES NO OTHER WARRANTIES OR REPRESENTATIONS OF ANY KIND WHATSOEVER, EXPRESS OR IMPLIED, EXCEPT THAT OF TITLE, AND ALL IMPLIED WARRANTIES INCLUDING ANY WARRANTY OF MERCHANTABILITY AND FITNESS FOR A PARTICULAR PURPOSE ARE HEREBY DISCLAIMED. LIMITATION OF LIABILITY: The remedies of purchaser set forth herein are exclusive, and the total liability of OMEGA with respect to this order, whether based on contract, warranty, negligence, indemnification, strict liability or otherwise, shall not exceed the purchase price of the component upon which liability is based. In no event shall OMEGA be liable for consequential, incidental or special damages.

CONDITIONS: Equipment sold by OMEGA is not intended to be used, nor shall it be used: (1) as a "Basic Component" under 30 CFR 21 (NRC), used in or with any nuclear installation or activity; or (2) in medical applications or used on humans. Should any Product(s) be used in or with any nuclear installation or activity, medical application, used on humans, or misused in any way, OMEGA assumes no responsibility as set forth in our basic WARRANTY/DISCLAIMER language, and, additionally, purchaser will indemnify OMEGA and hold OMEGA harmless from any liability or damage whatsoever arising out of the use of the Product(s) in such a manner.

## RETURN REQUESTS/INQUIRIES

Direct all warranty and repair requests/inquiries to the OMEGA Customer Service Department. BEFORE RETURNING ANY PRODUCT(S) TO OMEGA, PURCHASER MUST OBTAIN AN AUTHORIZED RETURN (AR) NUMBER FROM OMEGA'S CUSTOMER SERVICE DEPARTMENT (IN ORDER TO AVOID PROCESSING DELAYS). The assigned AR number should then be marked on the outside of the return package and on any correspondence.

The purchaser is responsible for shipping charges, freight, insurance and proper packaging to prevent breakage in transit.

FOR WARRANTY RETURNS, please have the following information available BEFORE contacting OMEGA:

1. Purchase Order number under which the product was PURCHASED.
2. Model and serial number of the product under warranty, and
3. Repair instructions and/or specific problems relative to the product.

FOR NON-WARRANTY REPAIRS, consult OMEGA for current repair charges. Have the following information available BEFORE contacting OMEGA:

1. Purchase Order number to cover the COST of the repair;
2. Model and serial number of the product, and
3. Repair instructions and/or specific problems relative to the product.

OMEGA's policy is to make running changes, not model changes, whenever an improvement is possible. This affords our customers the latest in technology and engineering.

OMEGA is a registered trademark of OMEGA ENGINEERING, INC.

© Copyright 2001 OMEGA ENGINEERING, INC. All rights reserved. This document may not be copied, photocopied, reproduced, translated, or reduced to any electronic medium or machine-readable form, in whole or in part, without the prior written consent of OMEGA ENGINEERING, INC.